

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25902

If you have any questions, please state the report number and date

Date: 12.04.2024

# **Report**

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 12.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

WDD2132161A753758



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25902 If you have any questions, please state the report number and date

Date: 12.04.2024

# Report

Subject Client Inspection date/location

**Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance Next vehicle inspection Service documentation **Trailer coupling Rain sensor Operating manual** Repainting

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 12.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra

Plastic parts could not be evaluated by means of paint

Estate Car Mercedes-Benz E 300 de T 9G-TRONIC 2.0 / WDD2132161A753758 1 25.10.2019 179.336 km Silber Metallic Diesel 1.950 cm<sup>3</sup> / 143 kW 5/5Automatic transmission 2 15.02.2023 / 134.838 km Available Swiveling

**Inspection Condition** 

Available Available

thickness measurement.

non-dismantled, roadworthy, traffic safe

Found



If you have any questions, please state the report number and date

Date: 12.04.2024

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 245/45 R18 front axle #2 275/40 R18 rear axle	Summer tyre on Aluminium rim	6/6 5/5

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	adequate	near-new
Disc	adequate	near-new

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Bumper front	Stone chip	Slight	
4	Door FL	Scratch	Slight	
5	Door entry FL	Scratch	Slight	
6	Bumper rear	Scratch	Slight	
7	Fender ri	Scratch	Slight	

### Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 200µm
- Roof; ~ 210µm
- Tailgate; ~ 191µm

12.04.2024 VIN: WDD2132161A753758; Report number: 202404-25902



If you have any questions, please state the report number and date

Date: 12.04.2024

- Fender le; ~ 160µm
- Door f.l.; ~ 180µm
- Door r.l.; ~ 180µm
- Side panel le.; ~ 180µm
- Fender ri.; ~ 230µm
- Door f.r.; ~ 190µm
- Door r.r.; ~ 190µm
- Side panel ri.; ~ 190µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

### **Test drive / Inspection**

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

### **Other information**

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 12.04.2024

Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 8 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 12.04.2024

## **Overview pictures**



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 12.04.2024



Image 7



Image 9



Image 11



Image 8



Image 10

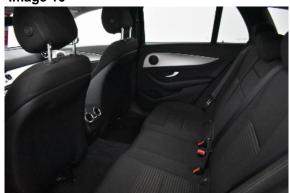


Image 12



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 12.04.2024

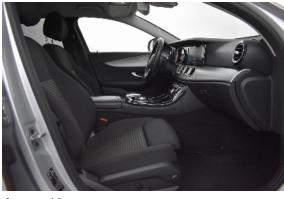




Image 14

Image 13

In Sie auch auf Meroedes me twee mercedes regulard entitie hit sowre die Servicehistorie ihres Patrzeugs date Wines	nden Sie dazu den Sicherhaltsoppe if	abesuch diesen SecOnde's unters rechts
iten		
E 300 de		
g 25.10.2019		
WDD 213216 1A 753758		
KS-MA799E		
02.2024		
159838 km e zusätzlichen kniormationen in krem Fahrzeug (Be fision Service)	fricbsanleitung, Serviceheft und S	Serviceintervallanzaiga) z
159838 km zasatcikien kilomationen in inten Fahrzoug (Se alen Servog) vicht Emil Frey Kassel/Göttingen GmbH		Serviceintervafianzeige) z 15.02.2023
159838 km Evalatachene Informationen in breis Fahrzeug (Bri belon Serwor) ericht Emil Frey Kassel/Gottingen GmbH Sandershäuser Straße 110 Kassel		
159838 km Statatachene Informationen in breis Fahrzeug (Bri telen Serwoy) aricht Emil Frey Kassel/Gottingen GmbH Sandershäuser Straße 110	Datum RepAuftrNr.	15.02.2023 307293 134838 km

Image 15

### **Damage pictures**



Image 1: Siehe Pos.1

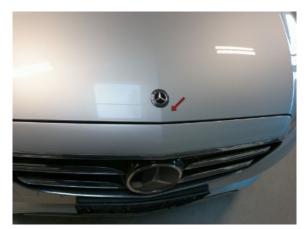


Image 2: Siehe Pos.2



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 12.04.2024



Image 3: Siehe Pos.3



Image 5: Siehe Pos.4



Image 7: Siehe Pos.6

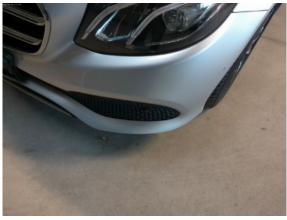


Image 4: Siehe Pos.3



Image 6: Siehe Pos.5



Image 8: Siehe Pos.7