



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024

Report

Subject	Report
Inspection date/location	18.09.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	MK-MS 1569
Vehicle Identification Number	W1K1186121N238734



REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	18.09.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	MK-MS 1569
Vehicle type	Estate Car
Manufacturer	Mercedes-Benz
Model / Sales description	CLA 200 d Shooting Brake 8G-DCT AMG Line 2.0
Key numbers HSN/TSN	2222 / AGV
Vehicle identification number	W1K1186121N238734
Previous owners	1
First registration	25.06.2021
Mileage	103.236 km
Colour / Colour Code	NACHTSCHWARZ
Fuel Type	Diesel
Cubic Capacity / Power	1.950 cm ³ / 110 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	1
Last maintenance	27.05.2024 / 100.298 km
Next vehicle inspection	01.06.2024
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/40 R19 front axle	Summer tyre on Aluminium rim	5/5
#2 225/40 R19 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Bumper front	Stone chip	Slight	
4	Mirror cap left	Stone chip	Slight	
5	Side panel right	Stone chip	Slight	
6	Mirror cap right	Stone chip	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Fender ri.; ~ 210µm
- Tailgate; ~ 180µm
- Bumper fr.;

A sample-like paint thickness measurement showed an increased paint thickness, which is

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024

almost certainly due to a repaired damage.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 18.09.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 13 overview pictures, 6 damage pictures

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024



Image 13

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2

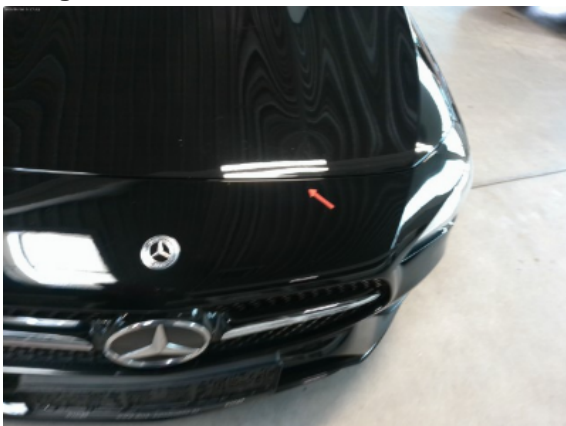


Image 3: Siehe Pos.3



Image 4: Siehe Pos.4

REPORTNUMBER: 202409-27652

If you have any questions, please state the report number and date

Date: 18.09.2024



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6