



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

Report

Subject	Report
Inspection date/location	18.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	B-TM 92592
Vehicle Identification Number	U5YPG812AKL704122

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	18.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	B-TM 92592
Vehicle type	Estate Car
Manufacturer	Kia
Model / Sales description	Sportage
Key numbers HSN/TSN	1260 / AEM
Vehicle identification number	U5YPG812AKL704122
Previous owners	2
First registration	15.11.2019
Mileage	85.092 km
Colour / Colour Code	WEISS
Fuel Type	Diesel
Cubic Capacity / Power	1.598 cm ³ / 85 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	1
Last maintenance	06.04.2023 / 70.580 km
Next vehicle inspection	01.11.2024
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 215/65 R16 front axle	Winter tyre on Aluminium rim	5/5
#2 215/65 R16 rear axle		4/4

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Tailgate panel	Scratch	Slight	
4	Bumper rear	Scratch	Slight	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 19.04.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 4 damage pictures

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024



Image 7



Image 8



Image 9



Image 10

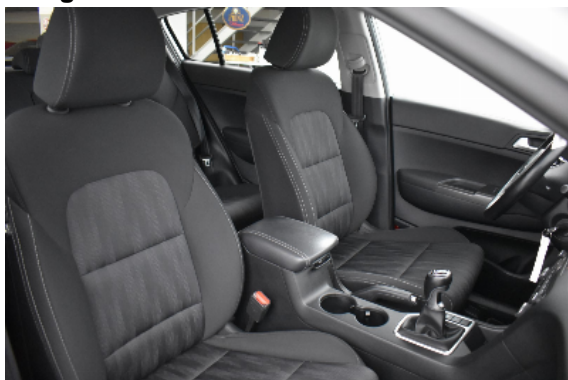


Image 11



Image 12

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024

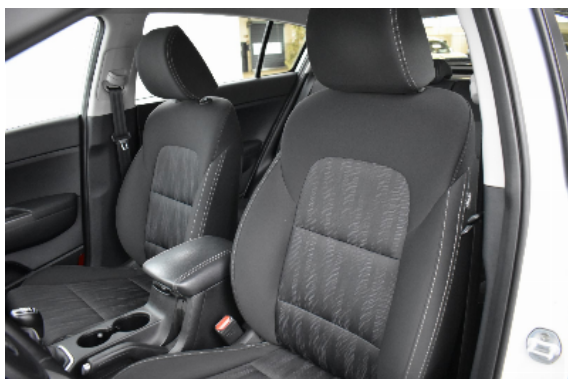


Image 13



Image 14

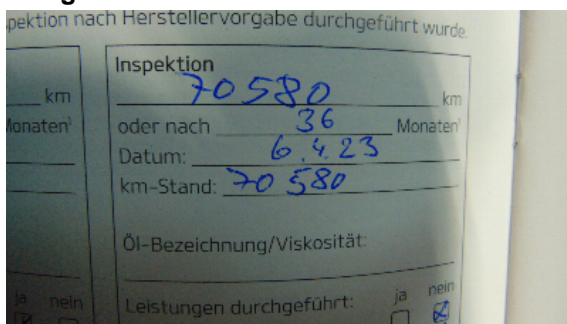


Image 15

Damage pictures

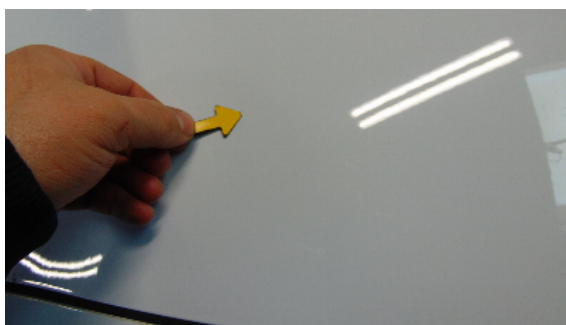


Image 1: siehe pos.1



Image 2: siehe pos.2

REPORTNUMBER: 202404-25981

If you have any questions, please state the report number and date

Date: 19.04.2024



Image 3: siehe pos.3



Image 4: siehe pos.4