



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024

Report

Subject	Report
Inspection date/location	14.03.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	PLÖ-WP 19
Vehicle Identification Number	WVWZZZAUZJW297602



REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	14.03.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	PLÖ-WP 19
Vehicle type	Saloon
Manufacturer	VW
Model / Sales description	Golf 1,0 TSI BMT
Key numbers HSN/TSN	0603 / CCR
Vehicle identification number	WVWZZZAUZJW297602
Previous owners	1
First registration	25.07.2018
Mileage	32.881 km
Colour / Colour Code	WEISS
Fuel Type	Petrol
Cubic Capacity / Power	999 cm ³ / 63 kW
Number of doors / seats	3 / 5
Transmission	Manual gearbox
Number of keys	2
Last maintenance	01.09.2023 / 31.380 km
Next vehicle inspection	01.07.2025
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 195/65 R15 front axle	Winter tyre on Steel rim	6/6
#2 195/65 R15 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Fender ri	Scratch	Slight	
4	Door FR	Scratch	Slight	
5	Bumper rear	Scratch	Slight	
6	Door FL	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 200µm
- Roof; ~ 150µm
- Tailgate; ~ 150µm
- Fender le; ~ 150µm
- Fender ri.; ~ 150µm

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024

- Door f.l.; ~ 150µm
- Door f.r.; ~ 150µm
- Side panel le.; ~ 150µm
- Side panel ri.; ~ 150µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 16.04.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 6 damage pictures

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024



Image 13

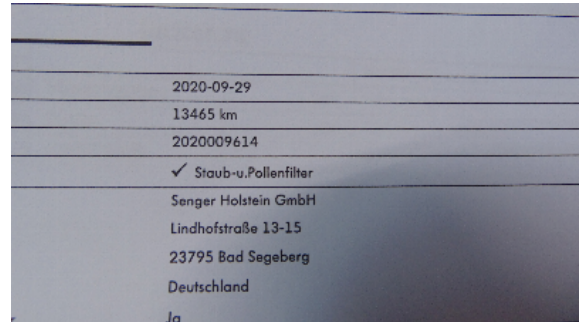


Image 14



Image 15

Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2

REPORTNUMBER: 202404-25541

If you have any questions, please state the report number and date

Date: 16.04.2024



Image 3: siehe pos.3



Image 4: siehe pos.4



Image 5: siehe pos.5

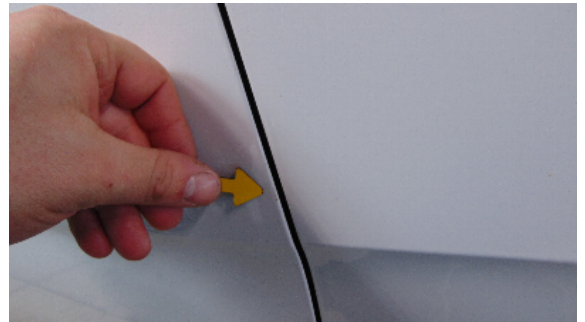


Image 6: siehe pos.6