

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202403-25595 If you have any questions, please state the report number and date

Date: 19.03.2024

Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 19.03.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

SB1K93BE00E010768



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202403-25595 If you have any questions, please state the report number and date

Date: 19.03.2024

Report

Subject Client Inspection date/location	Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 19.03.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra		
Registration number			
Vehicle type	Saloon		
Manufacturer	Toyota		
Model / Sales description	Corolla		
Key numbers HSN/TSN	/		
Vehicle identification number	SB1K93BE00E010768		
Previous owners			
First registration			
Mileage	64.298 km		
Colour / Colour Code			
Fuel Type	Hybrid/Diesel		
Cubic Capacity / Power	/		
Number of doors / seats	5 / 5		
Transmission	Automatic transmission		
Number of keys	1		
Last maintenance	09.03.2020 / 15.108 km		
Next vehicle inspection			
Service documentation	Available		
Trailer coupling	No		
Rain sensor	Available		
Operating manual	Available		
Repainting	Found		
	Plastic parts could not be evaluated by means of paint thickness measurement.		
Inspection Condition	non-dismantled, roadworthy, traffic safe		



If you have any questions, please state the report number and date

Date: 19.03.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/55 R16 front axle #2 205/55 R16 rear axle	Winter tyre on Aluminium rim	5/6 6/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Aluminium rim FR	Scratch	Slight	
4	Side panel right	Scratch	Slight	
5	Door FL	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Fender le; ~ 210µm
- Door f.l.; ~ 300µm
- Door r.l.; ~ 180µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.



If you have any questions, please state the report number and date

Date: 19.03.2024

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 19.03.2024

Imme

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 16 overview pictures, 5 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.03.2024

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.03.2024

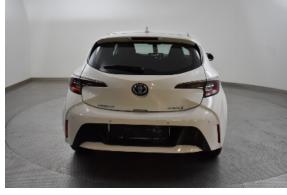










Image 11



Image 8





Image 12



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.03.2024





Image 13



Image 14



Image 16

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.03.2024



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4

Image 5: Siehe Pos.5