

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date Date: 04.04.2024

Report

Subject Report

Inspection date/location 04.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

Registration number EIC L 293

Vehicle Identification Number WBALM52030E159574

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 1 of 8



Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date

Report

Subject Report

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 1nspection date/location 04.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Registration number EIC L 293

Vehicle type Cabriolet/Roadster

ManufacturerBMWModel / Sales descriptionZ 4

Key numbers HSN/TSN 0005 / AOM

Vehicle identification number WBALM52030E159574

Previous owners 4

First registration 07.08.2009 **Mileage** 91.526 km

Colour / Colour Code

Fuel Type Petrol
Cubic Capacity / Power / 190 kW
Number of doors / seats 2 / 2

Transmission Manual gearbox

Number of keys 2

Last maintenance 07.07.2022 / 89.665 km

Next vehicle inspection

Service documentationAvailableTrailer couplingNoRain sensorAvailableOperating manualAvailableRepaintingFound

Plastic parts could not be evaluated by means of paint

thickness measurement.

Inspection Condition non-dismantled, roadworthy, traffic safe

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 2 of 8

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date Date: 04.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/40 R18 front axle	Summer tyre on Aluminium rim	7/7
#2 225/40 R18 rear axle		6/6

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	near-new	adequate
Disc	near-new	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Dent	Slight	
2	Bonnet	Scratch	Slight	
3	Bumper front	Stone chip	Slight	
4	Side panel left	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 300µm
- Roof; ~ 160µm
- Tailgate; ~ 170µm
- Fender ri.; ~ 170µm
- Door f.r.; ~ 180μm
- Side panel ri.; ~ 180µm
- Fender le; ~ 600µm
- Door f.l.; ~ 670μm

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 3 of 8

Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date

- Side panel le.; ~ 300μm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 04.04.2024

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 17 overview pictures, 4 damage pictures

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 4 of 8

Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 5 of 8

Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date



Image 7



Image 9



Image 11



Image 8



Image 10



Image 12

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 6 of 8

Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date



Image 13



Image 15



Image 17



Image 14



Image 16

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 7 of 8

Date: 04.04.2024

REPORTNUMBER: 202404-25796

If you have any questions, please state the report number and date

Damage pictures

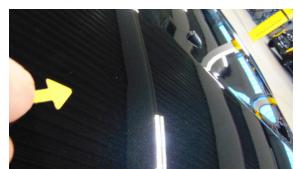


Image 1: siehe pos.1



Image 3: siehe pos.3

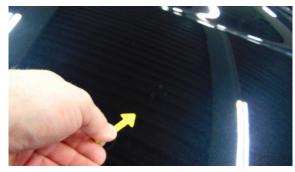


Image 2: siehe pos.2



Image 4: siehe pos.4

04.04.2024 VIN: WBALM52030E159574; Report number: 202404-25796 Page 8 of 8