

If you have any questions, please state the report number and date

Date: 25.04.2024

Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 25.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra HD-JE 182E WAUZZZFY1L2125853



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26074

If you have any questions, please state the report number and date

Date: 25.04.2024

Report

Subject Client Inspection date/location **Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance Next vehicle inspection Service documentation **Trailer coupling Rain sensor Operating manual** Repainting

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 25.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra **HD-JE 182E** Estate Car Audi Q5 50 TFSI e S tronic quattro Sports Utility 0588 / BRE WAUZZZFY1L2125853 1 16.11.2020 54.542 km Hybrid/Petrol 1.984 cm³ / 220 kW 5/5Automatic transmission 2 03.02.2022 / 18.373 km 01.11.2023 Available Swiveling Available Available Found Plastic parts could not be evaluated by means of paint thickness measurement. non-dismantled, roadworthy, traffic safe

Inspection Condition



If you have any questions, please state the report number and date

Date: 25.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/60 R18 front axle #2 235/60 R18 rear axle	Summer tyre on Aluminium rim	5/4 5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Side panel left	Scratch	Slight	
3	Bumper rear	Scratch	Slight	
4	Side panel right	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Fender le; ~ 170µm
- Door f.l.; ~ 190µm
- Door r.l.; ~ 180µm
- Side panel le.; ~ 190µm
- Engine bonnet; ~ 240µm
- Roof; ~ 200µm
- Tailgate; ~ 205µm
- Fender ri.; ~ 180µm



If you have any questions, please state the report number and date

Date: 25.04.2024

- Door f.r.; ~ 175µm
- Door r.r.; ~ 165µm
- Side panel ri.; ~ 200µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 25.04.2024

Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 16 overview pictures, 4 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 25.04.2024

Overview pictures



Image 1



Image 3



Image 5

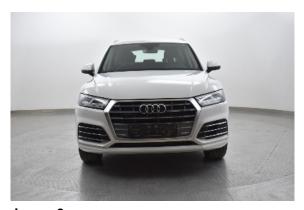




Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 25.04.2024



Image 7



Image 8



Image 9



Image 11

Image 10



Image 12



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 25.04.2024



Image 13





 Service-Nachweis
 CODO

 Service-Nachweis

Image 16

Damage pictures

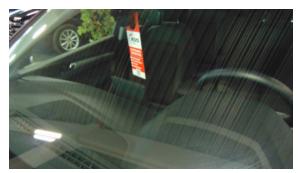


Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26074

If you have any questions, please state the report number and date

Date: 25.04.2024



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4