



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025

Report

Subject	Report
Inspection date/location	04.02.2025 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	GP-KA721E
Vehicle Identification Number	W1N1671171A413952

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	04.02.2025 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	GP-KA721E
Vehicle type	Estate Car
Manufacturer	Mercedes-Benz
Model / Sales description	GLE 350 de 4Matic 9G-TRONIC
Key numbers HSN/TSN	2222 / AFN
Vehicle identification number	W1N1671171A413952
Previous owners	1
First registration	21.06.2021
Mileage	107.956 km
Colour / Colour Code	SCHWARZ
Fuel Type	Hybrid/Diesel
Cubic Capacity / Power	1.950 cm ³ / 143 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	02.05.2023 / 54.093 km
Next vehicle inspection	01.07.2026
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 275/55 R19 front axle	Summer tyre on Aluminium rim	3/2
#2 275/55 R19 rear axle		2/2

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Aluminium rim FR	Scratch	Severe	
2	Windshield	Stone chip	Slight	
3	Bonnet	Stone chip	Slight	
4	Fender le	Stone chip	Slight	
5	Mirror cap left	Stone chip	Slight	
6	Side panel left	Scratch	Slight	
7	Bumper rear	Scratch	Slight	
8	Door RR	Scratch	Slight	
9	Mirror cap right	Stone chip	Slight	

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Bumper fr.;
- Tailgate; ~ 220µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 04.02.2025



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 9 damage pictures

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 7



Image 8



Image 9

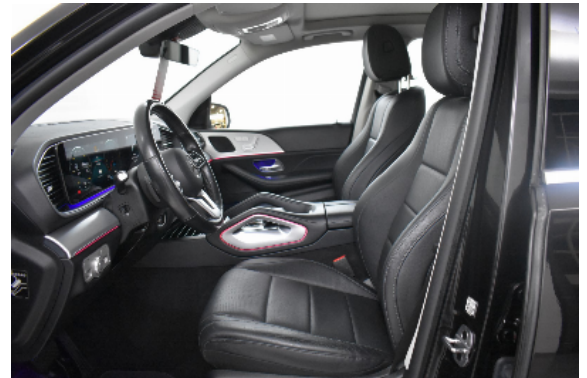


Image 10



Image 11



Image 12

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 13



Image 14

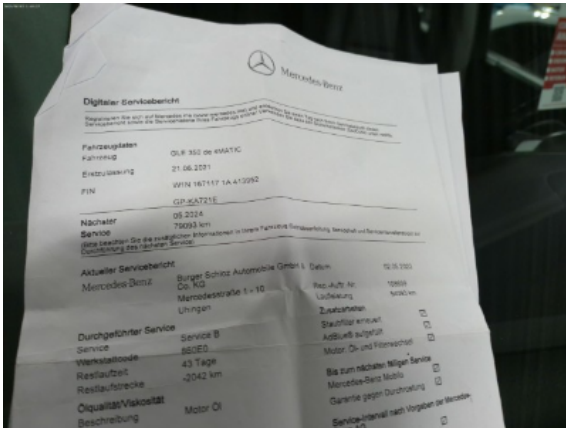


Image 15

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6



Image 7: Siehe Pos.7



Image 8: Siehe Pos.8

REPORTNUMBER: 202502-29267

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 9: Siehe Pos.9