

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202403-25536 If you have any questions, please state the report number and date

Date: 14.03.2024

Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 14.03.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra F-HE 1674 WBAJT51070BU74861



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202403-25536 If you have any questions, please state the report number and date

Date: 14.03.2024

Report

Subject Client Inspection date/location **Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance Next vehicle inspection Service documentation **Trailer coupling Rain sensor Operating manual** Repainting

Inspection Condition

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 14.03.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra F-HE 1674 Estate Car BMW 530I XDRIVE TOURING AUT: 0005 / CPT WBAJT51070BU74861 1 05.02.2019 136.324 km SCHWARZ Petrol 1.998 cm³ / 185 kW 5/5Automatic transmission 2 07.12.2023 / 134.233 km 01.01.2024 Available No Available Available Found Plastic parts could not be evaluated by means of paint thickness measurement. non-dismantled, roadworthy, traffic safe



If you have any questions, please state the report number and date

Date: 14.03.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 245/45 R18 front axle #2 175/40 R18 rear axle	Summer tyre on Aluminium rim	6/6 7/7

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	near-new	adequate
Disc	near-new	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Fender ri	Scratch	Slight	
4	Door FR	Scratch	Slight	
5	Door RR	Scratch	Slight	
6	Side panel right	Scratch	Slight	
7	Bumper rear	Scratch	Slight	
8	Side panel left	Scratch	Slight	
9	Door FL	Scratch	Slight	
10	Fender le	Scratch	Slight	



If you have any questions, please state the report number and date

Date: 14.03.2024

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 200µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 14.03.2024

Anne

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 10 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 14.03.2024

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 14.03.2024









Image 8







Image 12



Image 11



If you have any questions, please state the report number and date

Date: 14.03.2024



		Datum: Kilometer:	25.04.2022 84.005 km	Service:	43 8 RADICIDOS (21
,	OK	Datum: Kilometer:	03.04.2023 110.153 km	Service:	00074 BMW
5	OK	Datum: Kilometer:	18.09.2023 126.769 km		00074 BMW
	OK	Datum: Kilometer:	07.12.2023 134.233 km	Service:	01548 BMW

Image 14

Damage pictures



Image 1: siehe pos.1



Image 3: siehe pos.3



Image 2: siehe pos.2

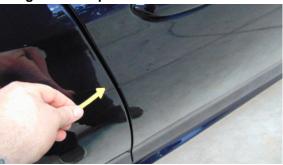


Image 4: siehe pos.4



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 14.03.2024

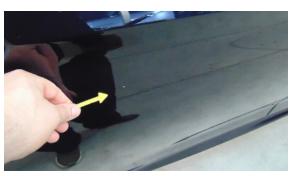


Image 5: siehe pos.5



Image 7: siehe pos.7



Image 9: siehe pos.9



Image 6: siehe pos.6



Image 8: siehe pos.8



Image 10: siehe pos.10