

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date Date: 19.09.2024

Report

Subject Report

Inspection date/location 19.09.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

Registration number OF-FA9301

Vehicle Identification Number SALCA2BN6LH877475

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 1 of 8



Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date

Report

Subject Report

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 19.09.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Registration number OF-FA9301

Vehicle type SUV/Off-road Vehicle/Pickup Truck

Manufacturer Land Rover

Model / Sales description Discovery Sport D150

Key numbers HSN/TSN

Vehicle identification number SALCA2BN6LH877475

Previous owners 1

First registration 16.11.2020 **Mileage** 147.295 km

Colour / Colour Code Santorini Black Metallic

Fuel Type Diesel

Cubic Capacity / Power 1.999 cm³ / 110 kW

Number of doors / seats 5 / 5

Transmission Automatic transmission

Number of keys

Last maintenance 11.01.2024 / 145.428 km

Next vehicle inspection

Service documentationAvailableTrailer couplingSwivelingRain sensorAvailableOperating manualAvailableRepaintingNot Found

Plastic parts could not be evaluated by means of paint

thickness measurement.

Inspection Condition non-dismantled, roadworthy, traffic safe

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 2 of 8

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date Date: 19.09.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/65 R17 front axle	Summer tyre on Aluminium rim	4/4
#2 235/65 R17 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	deficient
Disc	adequate	deficient

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Mirror cap right	Scratch	Slight	
4	Tailgate panel	Scratch	Slight	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable.** A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 3 of 8

Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

18me

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 19.09.2024

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 4 damage pictures

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 4 of 8

Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 5 of 8

Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date



Image 7



Image 9



Image 11



Image 8



Image 10



Image 12

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 6 of 8

Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date



Image 13



Image 15



Image 14

Damage pictures

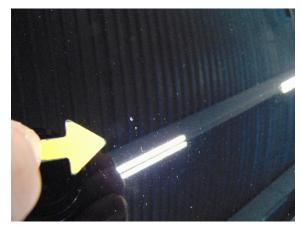


Image 1: siehe pos.1



Image 2: siehe pos.2

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 7 of 8

Date: 19.09.2024

REPORTNUMBER: 202409-27666

If you have any questions, please state the report number and date



Image 3: siehe pos.3



Image 4: siehe pos.4

19.09.2024 VIN: SALCA2BN6LH877475; Report number: 202409-27666 Page 8 of 8