

REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024

Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 18.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra D-IS 273 WF0WXXTACWJB24306



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024

Report

Subject Client Inspection date/location **Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance Next vehicle inspection Service documentation **Trailer coupling Rain sensor Operating manual** Repainting

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 18.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra D-IS 273 Minivan/Minibus Ford **Transit Courier** 8566 / BIK WF0WXXTACWJB24306 1 16.10.2018 36.798 km Weiss Diesel 1.498 cm³ / 55 kW 4/2 Manual gearbox 2 Unknown 01.10.2024 Nonexistent No Available Available Found Plastic parts could not be evaluated by means of paint thickness measurement. non-dismantled, roadworthy, traffic safe

Inspection Condition



Tires / Rims

REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024

Axis / Size	Tires	Profile [mm]
#1 185/65 R15 front axle #2 185/65 R15 rear axle	Winter tyre on Steel rim	6/6 8/8

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	Not detectable
Disc	adequate	Drum brakes

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Mirror cap right	Scratch	Slight	
4	Bumper rear	Scratch	Slight	
5	Tailgate	Scratch	Slight	
6	Door FL	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Fender le; ~ 160µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 19.04.2024

Anne

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 13 overview pictures, 6 damage pictures



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.04.2024

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 19.04.2024







Image 8



Image 9



Image 11



Image 12



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024



Image 13

Damage pictures



Image 1: siehe pos.1



Image 3: siehe pos.3

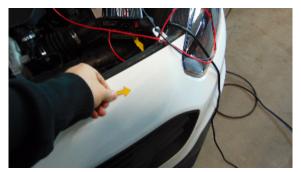


Image 2: siehe pos.2



Image 4: siehe pos.4



REPORTNUMBER: 202404-25988

If you have any questions, please state the report number and date

Date: 19.04.2024



Image 5: siehe pos.5



Image 6: siehe pos.6