

If you have any questions, please state the report number and date

Date: 03.04.2024

# Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 03.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra PB-BA 9994 WBAJN710X0BJ06549



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25773

If you have any questions, please state the report number and date

Date: 03.04.2024

# **Report**

Subject Client Inspection date/location **Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance Next vehicle inspection Service documentation **Trailer coupling Rain sensor Operating manual** Repainting

**Inspection Condition** 

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 03.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra PB-BA 9994 Estate Car BMW 540d Tour.xDr.235 Aut.5d 0005 / CPU WBAJN710X0BJ06549 1 13.06.2018 184.597 km SCHWARZ Diesel 2.993 cm<sup>3</sup> / 235 kW 5/5Automatic transmission 1 26.05.2023 / 170.878 km 01.12.2023 Available No Available Available Found Plastic parts could not be evaluated by means of paint thickness measurement. non-dismantled, roadworthy, traffic safe



If you have any questions, please state the report number and date

Date: 03.04.2024

#### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 245/45 R18 front axle #2 245/45 R18 rear axle	Summer tyre on Aluminium rim	6/6 5/5

The state of the tyres is roadworthy.

#### Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

# Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Door FR	Scratch	Slight	
3	Door RR	Scratch	Slight	
4	Tailgate panel	Scratch	Slight	
5	Bumper rear	Scratch	Slight	
6	Side panel left	Scratch	Slight	
7	Door RL	Scratch	Slight	

### **Previous damages / Repaintings**

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Side panel le.; ~ 160µm
- Fender ri.; ~ 180µm
- Door f.r.; ~ 180µm

03.04.2024 VIN: WBAJN710X0BJ06549; Report number: 202404-25773



If you have any questions, please state the report number and date

Date: 03.04.2024

- Door r.r.; ~ 180µm
- Side panel ri.; ~ 170µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

# **Test drive / Inspection**

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

# **Other information**

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 03.04.2024

1. Sime

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 16 overview pictures, 7 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 03.04.2024

# **Overview pictures**



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 03.04.2024







Image 9



Image 11



Image 8





Image 12



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 03.04.2024



Image 13





Image 14

	listorie Datum: 🚁 Kilometer:	07.06.2022 134.385 km		<u>90.2 MH₂ ≪ 8.25</u> 29344 BMW
	Datum: Kilometer:	01.07.2022 138.212 km	Service:	29344 BMW
	Datum: Kilometer:	14.04.2023 165.735 km		29344 BMW
		26.05.2023 170.878 km		

Image 16

# **Damage pictures**



Image 1: siehe pos.1



Image 2: siehe pos.2



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 03.04.2024



Image 3: siehe pos.3



Image 5: siehe pos.5



Image 7: siehe pos.7



Image 4: siehe pos.4

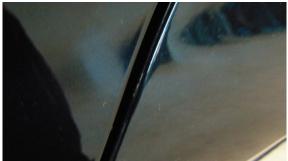


Image 6: siehe pos.6