



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

Report

Subject	Report
Inspection date/location	05.02.2026 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	M-D5667
Vehicle Identification Number	W1KWK8DB4PG122009



REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	05.02.2026 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	M-D5667
Vehicle type	Estate Car
Manufacturer	Mercedes-Benz
Model / Sales description	C 300
Key numbers HSN/TSN	2222 / AKG
Vehicle identification number	W1KWK8DB4PG122009
Previous owners	1
First registration	12.12.2022
Mileage	21.885 km
Colour / Colour Code	SCHWARZ
Fuel Type	Diesel
Cubic Capacity / Power	1.950 cm ³ / 143 kW
Number of doors / seats	2 / 4
Transmission	Automatic transmission
Number of keys	2
Last maintenance	30.04.2025 / 19.525 km
Next vehicle inspection	
Service documentation	Available
Trailer coupling	Swiveling
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/40 R19 front axle	Summer tyre on Aluminium rim	7/7
#2 225/40 R19 rear axle		7/7

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Aluminium rim RR	Scratch	Severe	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 05.02.2026



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 17 overview pictures, 3 damage pictures

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026



Image 13



Image 14

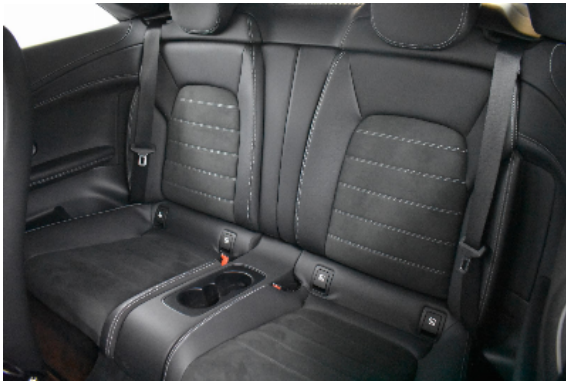


Image 15



Image 16



Image 17

REPORTNUMBER: 202602-32554

If you have any questions, please state the report number and date

Date: 05.02.2026

Damage pictures



Image 1:



Image 2:



Image 3: