

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date

Report

Subject Report

Inspection date/location 10.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

Registration number NDH-K212

Vehicle Identification Number WBAHS910903D23980

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 1 of 8



Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date

Report

Subject Report

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 10.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Registration number NDH-K212

Vehicle type SUV/Off-road Vehicle/Pickup Truck

Manufacturer BMW

Model / Sales descriptionX1 xDrive20iKey numbers HSN/TSN0005 / CKS

Vehicle identification number WBAHS910903D23980

Previous owners 2

First registration 14.09.2017 Mileage 148.347 km

Colour / Colour Code

Fuel Type Petrol

Cubic Capacity / Power 1.998 cm³ / 141 kW

Number of doors / seats 5 / 5

Transmission Automatic transmission

Number of keys 2

Last maintenance 12.09.2023 / 137.384 km

Next vehicle inspection 30.09.2024
Service documentation Available
Trailer coupling No

Rain sensor Available
Operating manual Available
Repainting Found

Plastic parts could not be evaluated by means of paint

thickness measurement.

Inspection Condition non-dismantled, roadworthy, traffic safe

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 2 of 8

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date Date: 10.05.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/50 R18 front axle	Summer tyre on Aluminium rim	5/5
#2 225/50 R18 rear axle		6/6

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Bumper rear	Scratch	Slight	
4	Tailgate panel	Scratch	Slight	
5	Door FL	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Side panel le.; ~ 200μm
- Engine bonnet; ~ 200µm
- Roof; ~ 200µm
- Fender ri.; ~ 170µm
- Door f.r.; ~ 250µm
- Door r.r.; $\sim 230 \mu m$
- Side panel ri.; ~ 180µm

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 3 of 8

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 10.05.2024

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 5 damage pictures

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 4 of 8

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 5 of 8

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date



Image 7



Image 9



Image 11



Image 8



Image 10



Image 12

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 6 of 8

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date





Image 14

Damage pictures

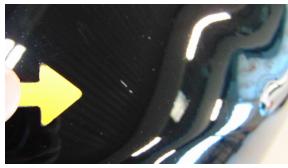


Image 1: siehe pos.1



Image 3: siehe pos.3



Image 2: siehe pos.2

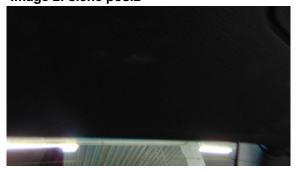


Image 4: siehe pos.4

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 7 of 8

Date: 10.05.2024

REPORTNUMBER: 202405-26239

If you have any questions, please state the report number and date



Image 5: siehe pos.5

10.05.2024 VIN: WBAHS910903D23980; Report number: 202405-26239 Page 8 of 8