



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023

Report

Subject	Report
Inspection date/location	25.07.2023 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	FD-MA 814
Vehicle Identification Number	WDB2304751F016017



REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	25.07.2023 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	FD-MA 814
Vehicle type	Cabriolet/Roadster
Manufacturer	Mercedes-Benz
Model / Sales description	SL500
Key numbers HSN/TSN	0710 / 000
Vehicle identification number	WDB2304751F016017
Previous owners	
First registration	14.06.2002
Mileage	90.171 km
Colour / Colour Code	
Fuel Type	Petrol
Cubic Capacity / Power	4.966 cm ³ / 225 kW
Number of doors / seats	3 / 2
Transmission	Automatic transmission
Number of keys	2
Last maintenance	18.05.2020 / 82.916 km
Next vehicle inspection	01.05.2025
Service documentation	Nonexistent
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 255/40 R18 front axle	Summer tyre on Aluminium rim	4/4
#2 285/35 R18 rear axle		6/6

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Dent	Medium	
3	Fender ri	Scratch	Slight	
4	Door FR	Scratch	Slight	
5	Side panel right	Scratch	Slight	
6	Door FL	Scratch	Slight	
7	Mirror cap left	Scratch	Slight	
8	Aluminium rim FR	Scratch	Medium	
9	Aluminium rim RR	Scratch	Medium	
10	Aluminium rim RL	Scratch	Medium	

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

The vehicle was found to have been properly and professionally repaired. Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 200µm
- Tailgate; ~ 160µm
- Fender le.; ~ 240µm
- Door f.l.; ~ 180µm
- Side panel le.; ~ 200µm
- Fender ri.; ~ 220µm
- Door f.r.; ~ 250µm
- Side panel ri.; ~ 260µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 26.07.2023



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 22 overview pictures, 10 damage pictures

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023



Image 13



Image 14



Image 15



Image 16



Image 17



Image 18

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023



Image 19



Image 20



Image 21



Image 22

Damage pictures



Image 1: pos.1

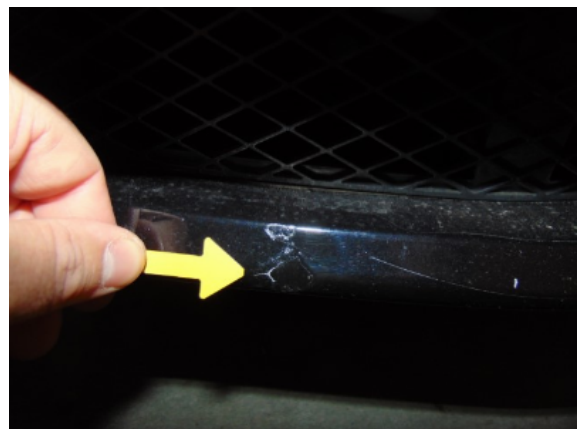


Image 2: 2

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023



Image 3: 3



Image 4: 4

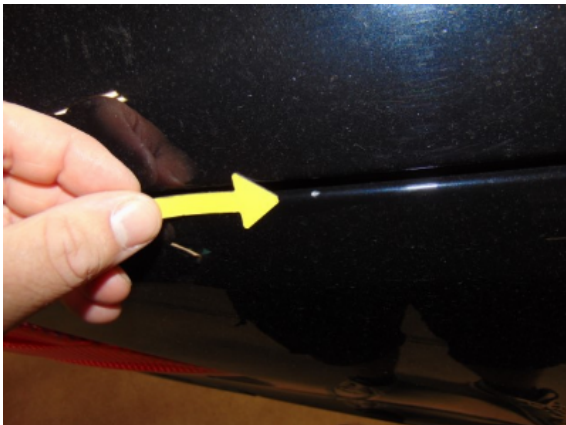


Image 5: 5



Image 6: 6



Image 7: 7



Image 8: 8

REPORTNUMBER: 202307-22973

If you have any questions, please state the report number and date

Date: 26.07.2023



Image 9: 9



Image 10: 10