



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	03.02.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	HH-GJ 5454
<b>Vehicle Identification Number</b>	WAUZZZFY1L2010881



REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	03.02.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	HH-GJ 5454
<b>Vehicle type</b>	Estate Car
<b>Manufacturer</b>	Audi
<b>Model / Sales description</b>	Q5 45 TDI quattro tiptronic sport Geschlossen
<b>Key numbers HSN/TSN</b>	0588 / BQI
<b>Vehicle identification number</b>	WAUZZZFY1L2010881
<b>Previous owners</b>	3
<b>First registration</b>	02.12.2019
<b>Mileage</b>	83.877 km
<b>Colour / Colour Code</b>	Grau
<b>Fuel Type</b>	Diesel
<b>Cubic Capacity / Power</b>	2.967 cm <sup>3</sup> / 170 kW
<b>Number of doors / seats</b>	5 / 5
<b>Transmission</b>	Automatic transmission
<b>Number of keys</b>	2
<b>Last maintenance</b>	02.09.2021 / 31.118 km
<b>Next vehicle inspection</b>	01.01.2025
<b>Service documentation</b>	Available
<b>Trailer coupling</b>	No
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Available
<b>Repainting</b>	Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/55 R19 front axle	Summer tyre on Aluminium rim	5/5
#2 235/55 R19 rear axle		5/5

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Door FR	Scratch	Slight	
4	Door RR	Scratch	Slight	
5	Side panel right	Scratch	Slight	
6	Tailgate panel	Scratch	Slight	
7	Aluminium rim FL	Scratch	Slight	

### Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Bumper fr.;
- Bumper re.;

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

## Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 04.02.2025



---

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 15 overview pictures, 7 damage pictures

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 13



Image 14



Image 15

## Damage pictures

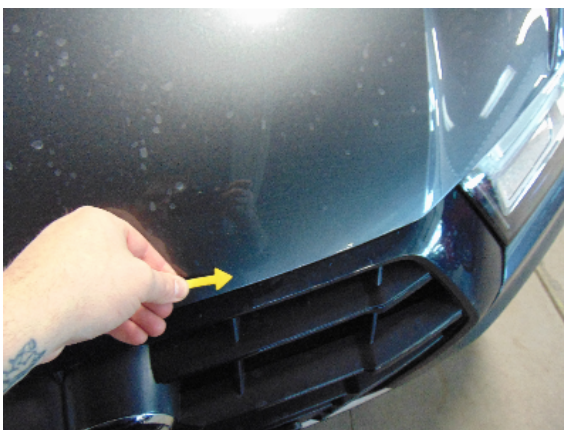


Image 1: siehe pos.1



Image 2: siehe pos.2

REPORTNUMBER: 202502-29258

If you have any questions, please state the report number and date

Date: 04.02.2025



Image 3: siehe pos.3



Image 4: siehe pos.4



Image 5: siehe pos.5



Image 6: siehe pos.6



Image 7: siehe pos.7