



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	23.01.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	F-MC 567
<b>Vehicle Identification Number</b>	W1N2477101J196469



REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	23.01.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	F-MC 567
<b>Vehicle type</b>	Estate Car
<b>Manufacturer</b>	Mercedes-Benz
<b>Model / Sales description</b>	GLA 180 d 8G-DCT Style Geschlossen
<b>Key numbers HSN/TSN</b>	2222 / ATH
<b>Vehicle identification number</b>	W1N2477101J196469
<b>Previous owners</b>	1
<b>First registration</b>	15.10.2020
<b>Mileage</b>	51.978 km
<b>Colour / Colour Code</b>	Schwarz
<b>Fuel Type</b>	Diesel
<b>Cubic Capacity / Power</b>	1.950 cm <sup>3</sup> / 85 kW
<b>Number of doors / seats</b>	5 / 5
<b>Transmission</b>	Automatic transmission
<b>Number of keys</b>	2
<b>Last maintenance</b>	19.01.2024 / 39.503 km
<b>Next vehicle inspection</b>	01.09.2025
<b>Service documentation</b>	Nonexistent
<b>Trailer coupling</b>	No
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Available
<b>Repainting</b>	Not Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 215/65 R17 front axle	Summer tyre on Aluminium rim	5/5
#2 215/65 R17 rear axle		5/5

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Mirror cap right	Scratch	Slight	
4	Door FR	Scratch	Slight	
5	Door RR	Dent	Slight	
6	Side panel right	Dent	Slight	
7	Bumper rear	Scratch	Slight	
8	Tailgate panel	Scratch	Slight	

### Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025

pre-damages, repainting or repairs can not be ruled out.

## Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 24.01.2025



---

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 14 overview pictures, 8 damage pictures

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025



Image 13

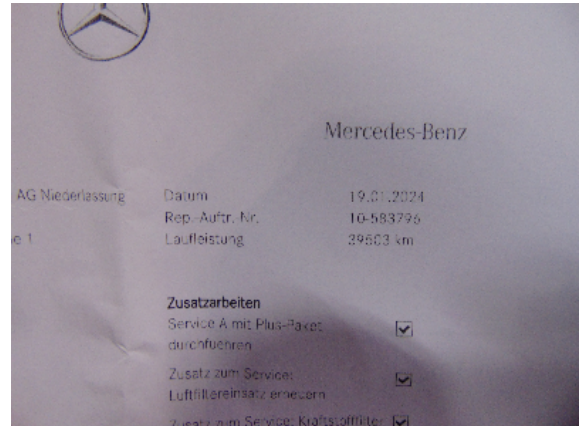


Image 14

### Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2



Image 3: siehe pos.3

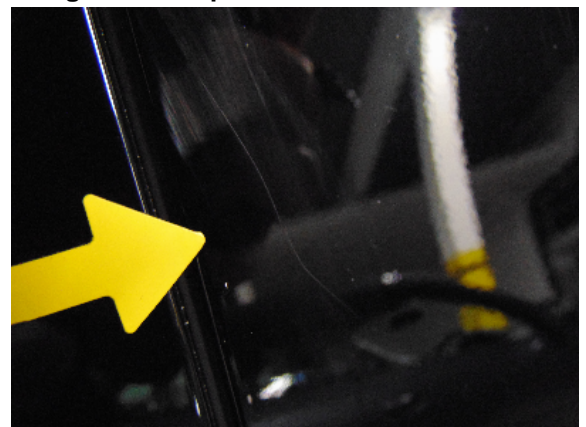


Image 4: siehe pos.4

REPORTNUMBER: 202501-29135

If you have any questions, please state the report number and date

Date: 24.01.2025



Image 5: siehe pos.5



Image 6: siehe pos.6



Image 7: siehe pos.7



Image 8: siehe pos.8