



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	10.04.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	E-TN9469
<b>Vehicle Identification Number</b>	YV1XZ72BDL2266134



REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	10.04.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	E-TN9469
<b>Vehicle type</b>	Estate Car
<b>Manufacturer</b>	Volvo
<b>Model / Sales description</b>	XC40 D3 Geartronic
<b>Key numbers HSN/TSN</b>	9101 / BMD
<b>Vehicle identification number</b>	YV1XZ72BDL2266134
<b>Previous owners</b>	1
<b>First registration</b>	08.01.2020
<b>Mileage</b>	125.371 km
<b>Colour / Colour Code</b>	Black Stone
<b>Fuel Type</b>	Diesel
<b>Cubic Capacity / Power</b>	1.969 cm <sup>3</sup> / 110 kW
<b>Number of doors / seats</b>	5 / 5
<b>Transmission</b>	Automatic transmission
<b>Number of keys</b>	3
<b>Last maintenance</b>	07.07.2023 / 125.023 km
<b>Next vehicle inspection</b>	01.03.2025
<b>Service documentation</b>	Available
<b>Trailer coupling</b>	Swiveling
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Available
<b>Repainting</b>	Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/60 R17 front axle	Summer tyre on Aluminium rim	3/3
#2 235/60 R17 rear axle		5/5

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Severe	
2	Bonnet	Stone chip	Medium	
3	Bumper front	Stone chip	Slight	
4	Door FL	Scratch		
5	Tailgate	Scratch	Slight	
6	Bumper rear	Scratch	Scratch	
7	Fender ri	Stone chip	Slight	

### Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Door f.l.; ~ 160µm

A sample-like paint thickness measurement showed an increased paint thickness, which is

REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024

almost certainly due to a repaired damage.

## Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 11.04.2024



---

Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 15 overview pictures, 9 damage pictures

REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6



REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024



Image 13



Image 14

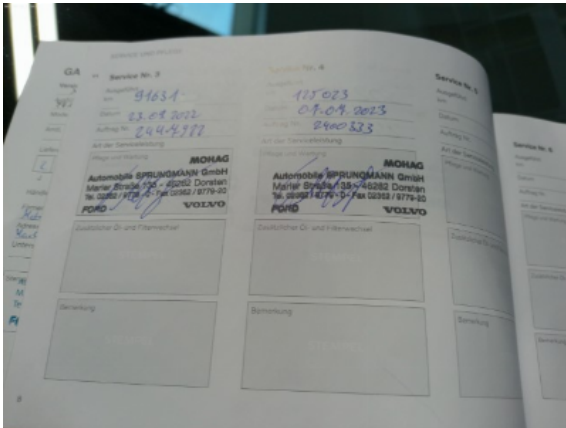


Image 15

### Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.1



REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024



Image 3: Siehe Pos.2



Image 4: Siehe Pos.3



Image 5: Siehe Pos.3



Image 6: Siehe Pos.4



Image 7: Siehe Pos.5



Image 8: Siehe Pos.6



REPORTNUMBER: 202404-25867

If you have any questions, please state the report number and date

Date: 11.04.2024



Image 9: Siehe Pos.7