



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024

Report

Subject	Report
Inspection date/location	23.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	E-TN999
Vehicle Identification Number	WBAJU810009D74691

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	23.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	E-TN999
Vehicle type	Estate Car
Manufacturer	BMW
Model / Sales description	X5 xDrive30d
Key numbers HSN/TSN	0005 / DAD
Vehicle identification number	WBAJU810009D74691
Previous owners	1
First registration	28.09.2020
Mileage	104.377 km
Colour / Colour Code	Carbonschwarz Metallic
Fuel Type	Diesel
Cubic Capacity / Power	2.993 cm ³ / 210 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	14.06.2023 / 89.770 km
Next vehicle inspection	01.09.2025
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 295/35 R21 front axle	Summer tyre on Aluminium rim	5/5
#2 315/35 R21 rear axle		4/4

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Severe	
2	Bumper front	Stone chip	Slight	
3	Fender le	Stone chip	Slight	
4	Mirror cap left	Stone chip	Slight	
5	Door FL	Dent	Slight	
6	Door RL	Scratch	Slight	
7	Side panel left	Scratch	Medium	
8	Bumper rear	Scratch	Slight	
9	Tank cap	Scratch	Severe	
10	Door RR	Scratch	Slight	
11	Door FR	Scratch	Medium	

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 03.05.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 16 overview pictures, 12 damage pictures

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024



Image 13



Image 14

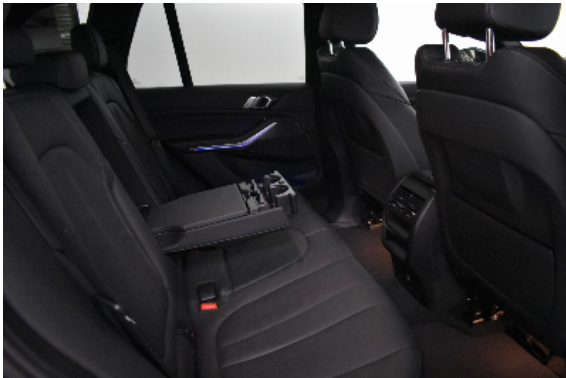


Image 15



Image 16

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024



Image 3: Siehe Pos.2



Image 4: Siehe Pos.3



Image 5: Siehe Pos.4



Image 6: Siehe Pos.5



Image 7: Siehe Pos.6



Image 8: Siehe Pos.7

REPORTNUMBER: 202405-26049

If you have any questions, please state the report number and date

Date: 03.05.2024



Image 9: Siehe Pos.8



Image 10: Siehe Pos.9



Image 11: Siehe Pos.10



Image 12: Siehe Pos.11