



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Inspection date/location	22.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	K-HS1490
Vehicle Identification Number	W1N1671211A247809



REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	22.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	K-HS1490
Vehicle type	Estate Car
Manufacturer	Mercedes-Benz
Model / Sales description	GLE 350 d 4Matic 9G-TRONIC
Key numbers HSN/TSN	2222 / AEX
Vehicle identification number	W1N1671211A247809
Previous owners	1
First registration	08.10.2020
Mileage	153.844 km
Colour / Colour Code	Schwarz
Fuel Type	Diesel
Cubic Capacity / Power	2.925 cm ³ / 200 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	1
Last maintenance	13.04.2023 / 127.980 km
Next vehicle inspection	01.11.2025
Service documentation	Service history incomplete (Von Ölzettel abgelesen)
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 275/50 R20 front axle	Summer tyre on Aluminium rim	6/6
#2 275/50 R20 rear axle		4/4

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Door FL	Dent	Slight	
3	Door entry FL		Slight	
4	Seat FL	Crack	Severe	
5	Door RL	Scratch	Slight	
6	Bumper rear	Scratch	Slight	
7	Tailgate panel	Scratch	Slight	
8	Door entry RR	Scratch	Slight	
9	Door panel RR	Scratch	Slight	
10	Door FR		Slight	
11	Fender ri	Stone chip	Slight	

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Door r.l.; ~ 350µm
- Tailgate; ~ 170µm
- Door f.r.; ~ 200µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 22.04.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 18 overview pictures, 12 damage pictures

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11

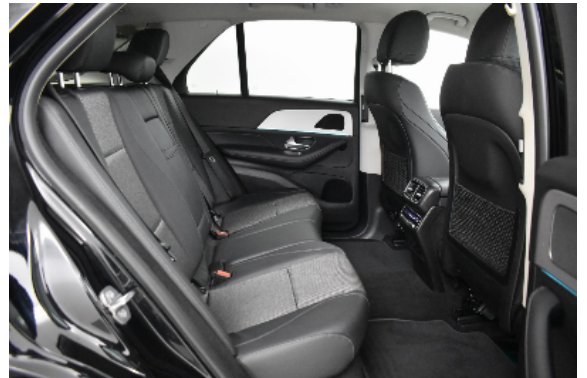


Image 12

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 13



Image 14



Image 15

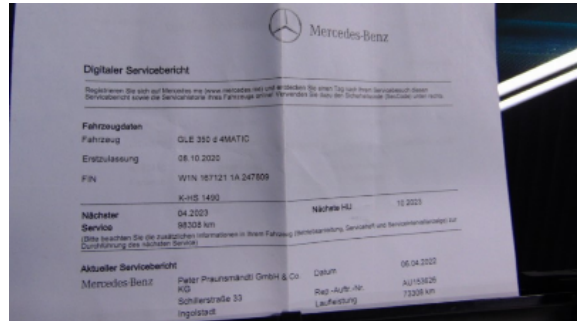


Image 16



Image 17



Image 18

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6



Image 7: Siehe Pos.7



Image 8: Siehe Pos.8

REPORTNUMBER: 202404-26035

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 9: Siehe Pos.9

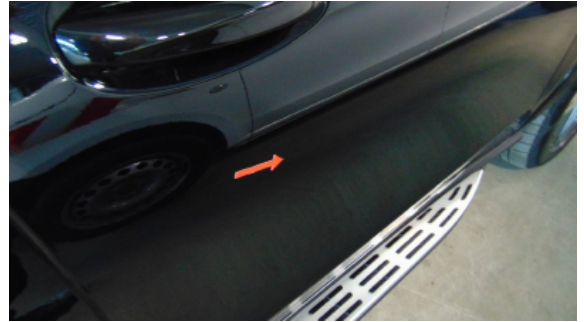


Image 10: Siehe Pos.10



Image 11: Siehe Pos.10



Image 12: Siehe Pos.11