

Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date

Report

Subject Report

Inspection date/location 25.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

Registration number E-IS1145

Vehicle Identification Number WAUZZZF24MN060833

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 1 of 8



Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date

Report

Subject Report

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra Inspection date/location 25.04.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Registration number E-IS1145 Vehicle type Estate Car Manufacturer Audi

Model / Sales description A6 Avant 35 TDI S tronic

Key numbers HSN/TSN

Vehicle identification number WAUZZZF24MN060833

Previous owners 2

First registration 19.05.2021

Mileage 131.974 km

Colour / Colour Code Brillantschwarz

Fuel Type Diesel

Cubic Capacity / Power 1.968 cm³ / 120 kW

Number of doors / seats 5 / 5

Transmission Automatic transmission

Number of keys

Last maintenance 08.07.2022 / 62.402 km

Next vehicle inspection

Service documentationAvailableTrailer couplingNoRain sensorAvailableOperating manualAvailableRepaintingFound

Plastic parts could not be evaluated by means of paint

thickness measurement.

Inspection Condition non-dismantled, roadworthy, traffic safe

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 2 of 8

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date Date: 25.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/55 R18 front axle	Summer tyre on Aluminium rim	7/7
#2 225/55 R18 rear axle		7/7

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Bumper front	Stone chip	Slight	
4	Door FL	Scratch	Slight	
5	Door entry RR	Scratch	Severe	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Side panel le.; ~ 210µm

- Tailgate; ~ 190µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 3 of 8

Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 25.04.2024

Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 6 damage pictures

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 4 of 8

Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6

Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12


Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date



Image 13 Image 14

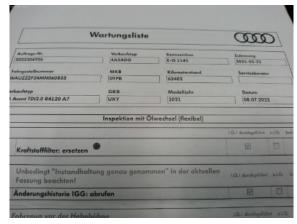

Damage pictures

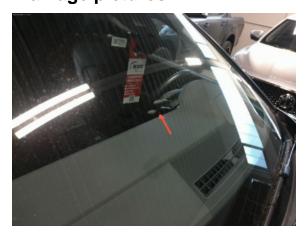


Image 1: Siehe Pos.1



Image 3: Siehe Pos.3

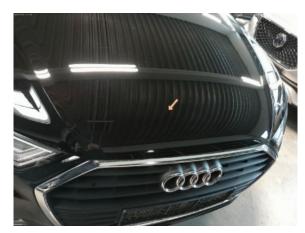


Image 2: Siehe Pos.2



Image 4: Siehe Pos.3

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 7 of 8

Date: 25.04.2024

REPORTNUMBER: 202404-26075

If you have any questions, please state the report number and date

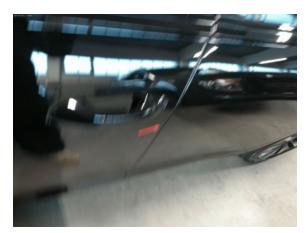


Image 5: Siehe Pos.4



Image 6: Siehe Pos.5

25.04.2024 VIN: WAUZZZF24MN060833; Report number: 202404-26075 Page 8 of 8