



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	31.01.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	
<b>Vehicle Identification Number</b>	WDC2533091F433547

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	31.01.2025   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	
<b>Vehicle type</b>	Estate Car
<b>Manufacturer</b>	Mercedes-Benz
<b>Model / Sales description</b>	GLC Coupe
<b>Key numbers HSN/TSN</b>	/
<b>Vehicle identification number</b>	WDC2533091F433547
<b>Previous owners</b>	
<b>First registration</b>	09.03.2018
<b>Mileage</b>	88.028 km
<b>Colour / Colour Code</b>	schwarz
<b>Fuel Type</b>	Diesel
<b>Cubic Capacity / Power</b>	/ 150 kW
<b>Number of doors / seats</b>	5 / 5
<b>Transmission</b>	Automatic transmission
<b>Number of keys</b>	2
<b>Last maintenance</b>	22.12.2021 / 88.028 km
<b>Next vehicle inspection</b>	01.08.2026
<b>Service documentation</b>	Available
<b>Trailer coupling</b>	Detachable
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Available
<b>Repainting</b>	Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/55 R19 front axle	Summer tyre on Aluminium rim	4/4
#2 255/50 R19 rear axle		4/4

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Door RR	Scratch	Slight	

### Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 280µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025

## Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 31.01.2025



---

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 15 overview pictures, 3 damage pictures

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025



Image 13



Image 14

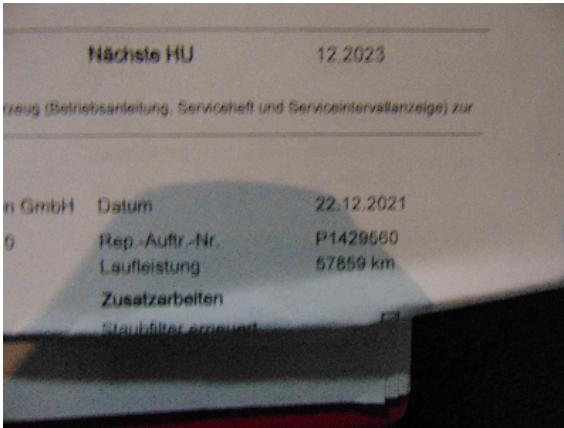


Image 15

### Damage pictures

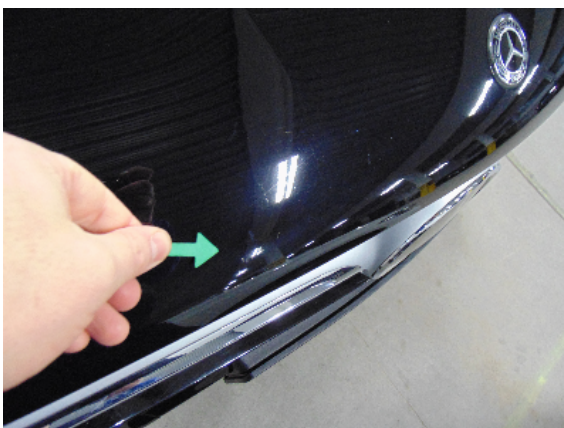


Image 1: siehe pos.1



Image 2: siehe pos.2

REPORTNUMBER: 202501-29233

If you have any questions, please state the report number and date

Date: 31.01.2025



**Image 3: siehe pos.3**