

If you have any questions, please state the report number and date

Date: 10.05.2024

Report

Subject Inspection date/location

Client Registration number Vehicle Identification Number Report 10.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra GD-LE 12 TMBJJ7NU7L2025508



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26242 If you have any questions, please state the report number and date

Date: 10.05.2024

Report

Subject Client Inspection date/location **Registration number** Vehicle type Manufacturer Model / Sales description Key numbers HSN/TSN Vehicle identification number **Previous owners First registration** Mileage **Colour / Colour Code** Fuel Type **Cubic Capacity / Power** Number of doors / seats Transmission Number of kevs Last maintenance

Report Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 10.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra GD-LE 12 Estate Car Skoda Karog 2.0 TDI SCR 8004 / ATL TMBJJ7NU7L2025508 2 16.12.2019 67.818 km SCHWARZ Diesel 1.968 cm³ / 110 kW 5/5Manual gearbox 3 Unknown 01.01.2025 Nonexistent No Available Available Not Found Plastic parts could not be evaluated by means of paint thickness measurement. non-dismantled, roadworthy, traffic safe

Inspection Condition

Next vehicle inspection

Service documentation

Trailer coupling

Operating manual

Rain sensor

Repainting



If you have any questions, please state the report number and date

Date: 10.05.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 215/55 R17 front axle #2 215/55 R17 rear axle	Summer tyre on Aluminium rim	3/3 3/3

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Door RR	Scratch	Slight	
4	Side panel right	Scratch	Slight	
5	Door RL	Scratch	Slight	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable.** A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.



If you have any questions, please state the report number and date

Date: 10.05.2024

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 10.05.2024

Anne

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 13 overview pictures, 5 damage pictures



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 10.05.2024

Overview pictures



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6



If you have any questions, please state the report number and date

Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

Date: 10.05.2024











Image 11



Image 8





Image 12

Page 6 of 8



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26242

If you have any questions, please state the report number and date

Date: 10.05.2024



Image 13

Damage pictures



Image 1: siehe pos.1



Image 3: siehe pos.3

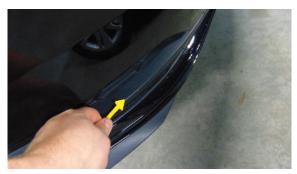


Image 2: siehe pos.2

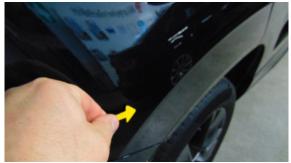


Image 4: siehe pos.4



Gerlach & Schröder GbR Nürnberger Str. 34 DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26242

If you have any questions, please state the report number and date

Date: 10.05.2024

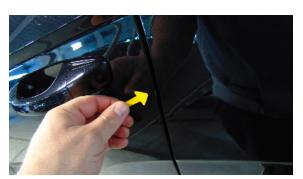


Image 5: siehe pos.5