



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Inspection date/location	22.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	LRO-HC 145
Vehicle Identification Number	WF0PXXGCHPJB46972



REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	22.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	LRO-HC 145
Vehicle type	Estate Car
Manufacturer	Ford
Model / Sales description	Focus Turnier 2.0 EcoBlue
Key numbers HSN/TSN	8566 / BQQ
Vehicle identification number	WF0PXXGCHPJB46972
Previous owners	1
First registration	13.11.2018
Mileage	129.441 km
Colour / Colour Code	grau metallic
Fuel Type	Diesel
Cubic Capacity / Power	1.998 cm ³ / 110 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	1
Last maintenance	06.11.2023 / 123.577 km
Next vehicle inspection	01.11.2025
Service documentation	Service history incomplete (Von Ölzettel abgelsen)
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 215/50 R17 front axle	Summer tyre on Aluminium rim	7/7
#2 215/50 R17 rear axle		6/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Aluminium rim FR	Scratch	Slight	
2	Bumper front		Severe	
3	Fender le	Scratch	Slight	
4	Windshield	Stone chip	Slight	
5	Door FL	Scratch	Slight	
6	Seat FL		Slight	
7	Door RL	Scratch	Medium	
8	Door entry RL	Scratch	Slight	
9	Side panel left	Scratch	Slight	
10	Bumper rear	Scratch	Slight	
11	Door RR	Stone chip	Slight	
12	Door entry RR	Scratch	Slight	

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Door f.r.; ~ 170µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 22.04.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 17 overview pictures, 12 damage pictures

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 13



Image 14



Image 15

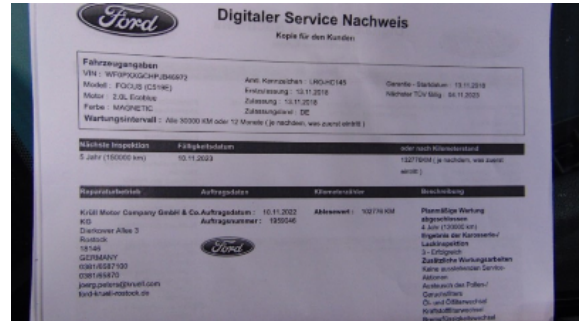


Image 16



Image 17

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6



Image 7: Siehe Pos.7



Image 8: Siehe Pos.8

REPORTNUMBER: 202404-26026

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 9: Siehe Pos.9



Image 10: Siehe Pos.10



Image 11: Siehe Pos.11



Image 12: Siehe Pos.12