



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Inspection date/location	19.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	K-JU 1262
Vehicle Identification Number	WF0NXXGCHNJR65833



REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	19.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	K-JU 1262
Vehicle type	Estate Car
Manufacturer	Ford
Model / Sales description	Focus 1.5 ECOBLUE START-STOPP-SYSTEM AUT.
Key numbers HSN/TSN	8566 / BPU
Vehicle identification number	WF0NXXGCHNJR65833
Previous owners	1
First registration	27.11.2018
Mileage	156.273 km
Colour / Colour Code	WEISS
Fuel Type	Diesel
Cubic Capacity / Power	1.498 cm ³ / 88 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	15.03.2023 / 136.290 km
Next vehicle inspection	01.10.2025
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/60 r16 front axle	Summer tyre on Aluminium rim	7/7
#2 205/60 r16 rear axle		6/6

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Bumper rear	Scratch	Slight	
4	Mirror cap right	Stone chip	Slight	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 22.04.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 17 overview pictures, 4 damage pictures

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 13



Image 14



Image 15

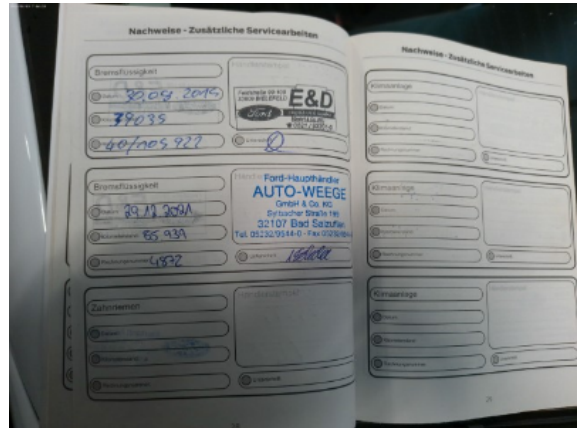


Image 16

Wartungsdatum	Fälligkeitstermin	Zustellung	Zustellungstermin
07.08.2023	angepasst für aktuellen, durchschnittlichen Jahreskilometerstand (37679KM)		
18.03.2024	bei normaler Jahresterfassung		

Wartungsdatum	Auftragsnummer	Kilometerzähler	Ablisewert	Beschreibung
15.03.2023	762377	136290 KM		Planmäßige Wartung abgeschlossen 9 Juli (135000 km) Ergebnis der Karosserie- / Lackinspektion: Nicht durchgeführt Zusätzliche Wartungsarbeiten: Keine ausstehenden Serviceaktionen Austausch der Wischerblätter Austausch des Wischerblatt (härten) Motoröl erneuern
18.10.2022	27.11.18	120919 KM		Planmäßige Wartung abgeschlossen 7 Juli (105000 km) Ergebnis der Karosserie- / Lackinspektion: 3 - Erfolgreich Zusätzliche Wartung: Keine ausstehenden

Image 17

REPORTNUMBER: 202404-26015

If you have any questions, please state the report number and date

Date: 22.04.2024

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Image 3: Siehe Pos.3

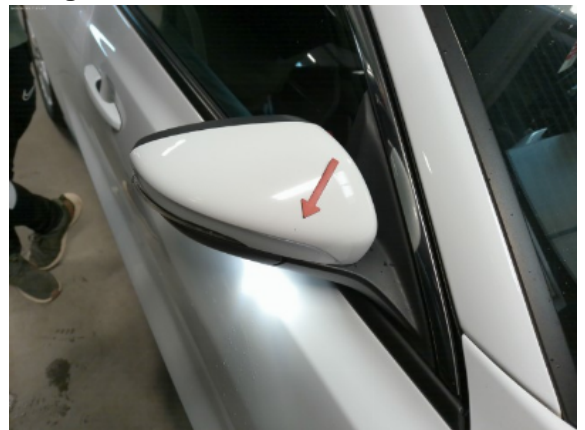


Image 4: Siehe Pos.4