



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	27.04.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	BM-CC 6763
<b>Vehicle Identification Number</b>	WF0WXXTACWKL61794



REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	27.04.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	BM-CC 6763
<b>Vehicle type</b>	Minivan/Minibus
<b>Manufacturer</b>	Ford
<b>Model / Sales description</b>	Transit COURIER
<b>Key numbers HSN/TSN</b>	8566 / BQD
<b>Vehicle identification number</b>	WFOWXXTACWKL61794
<b>Previous owners</b>	1
<b>First registration</b>	30.08.2019
<b>Mileage</b>	26.834 km
<b>Colour / Colour Code</b>	SILBER
<b>Fuel Type</b>	Diesel
<b>Cubic Capacity / Power</b>	1.498 cm <sup>3</sup> / 74 kW
<b>Number of doors / seats</b>	5 / 2
<b>Transmission</b>	Manual gearbox
<b>Number of keys</b>	1
<b>Last maintenance</b>	12.12.2022 / 22.338 km
<b>Next vehicle inspection</b>	01.11.2023
<b>Service documentation</b>	Available
<b>Trailer coupling</b>	No
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Available
<b>Repainting</b>	Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 185/60 R15 front axle	Winter tyre on Steel rim with wheel cover	6/5
#2 185/60 R15 rear axle		8/8

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bumper front		Slight	
2	Bonnet		Medium	
3	Windshield	Stone chip	Medium	
4	Seat FL		Slight	
5	Mirror cap right		Slight	
6			Slight	
7	Bumper rear		Medium	

### Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Bumper fr.;
- Fender le; ~ 170µm
- Door f.l.; ~ 145µm

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

- Side panel le.; ~ 220µm
- Engine bonnet; ~ 170µm
- Roof; ~ 235µm
- Fender ri.; ~ 185µm
- Door f.r.; ~ 195µm
- Door r.r.; ~ 155µm
- Side panel ri.; ~ 240µm
- Door r.l.; ~ 220µm
- Door r.r.; ~ 220µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

## Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 29.04.2024



---

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 11 overview pictures, 7 damage pictures

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024



Image 7



Image 8



Image 9



Image 10

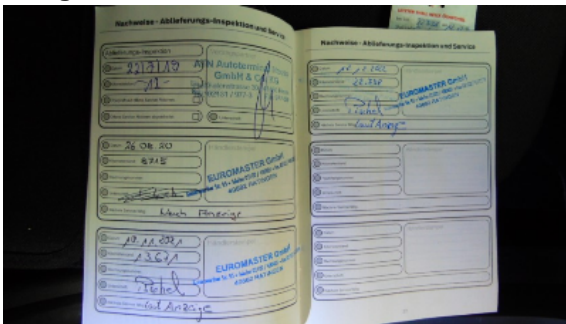


Image 11

REPORTNUMBER: 202404-26104

If you have any questions, please state the report number and date

Date: 29.04.2024

## Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6



Image 7: Siehe Pos.7