



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

Report

Subject	Report
Inspection date/location	03.05.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	
Vehicle Identification Number	VF3MCYHZJKS393233



REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	03.05.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	
Vehicle type	Estate Car
Manufacturer	Peugeot
Model / Sales description	5008 1.5 BLUEHDI 130 ALLURE LTD
Key numbers HSN/TSN	/
Vehicle identification number	VF3MCYHZJKS393233
Previous owners	1
First registration	06.12.2019
Mileage	84.554 km
Colour / Colour Code	WEISS
Fuel Type	Diesel
Cubic Capacity / Power	1.499 cm ³ / 96 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	2
Last maintenance	23.06.2022 / 58.663 km
Next vehicle inspection	
Service documentation	Available
Trailer coupling	Detachable
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/55 R19 front axle	Summer tyre on Aluminium rim	4/4
#2 205/55 R19 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Aluminium rim FR	Scratch	Medium	
2	Aluminium rim FL	Scratch	Medium	
3	Bumper front	Scratch	Medium	
4	Door entry RR	Scratch	Medium	
5	Side panel right	Scratch	Medium	
6	Door entry RL	Scratch	Medium	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 04.05.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 19 overview pictures, 6 damage pictures

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024



Image 13



Image 14



Image 15



Image 16



Image 17



Image 18

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

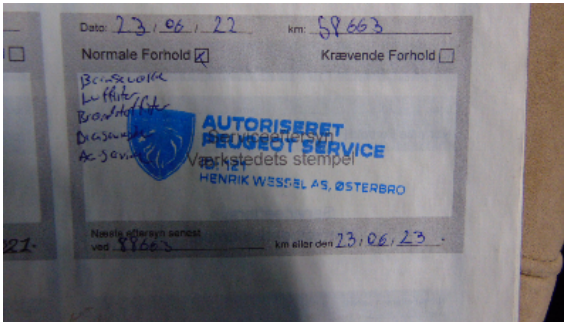


Image 19

Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2



Image 3: siehe pos.3



Image 4: siehe pos.4

REPORTNUMBER: 202405-26181

If you have any questions, please state the report number and date

Date: 04.05.2024

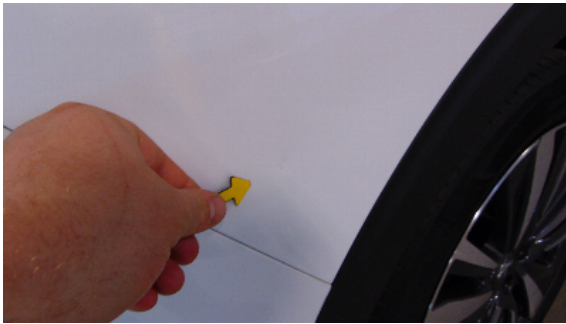


Image 5: siehe pos.5

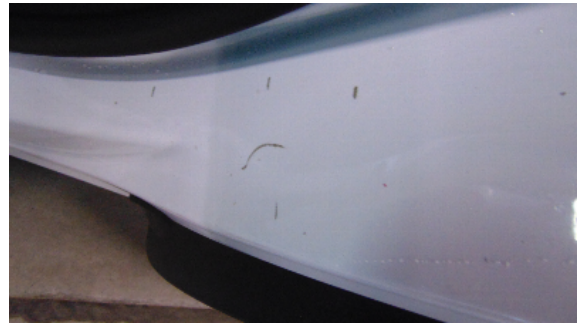


Image 6: siehe pos.6