



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024

Report

Subject	Report
Inspection date/location	04.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	B-PE 292
Vehicle Identification Number	YV1UZK5VCM1740476



REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	04.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	B-PE 292
Vehicle type	Estate Car
Manufacturer	Volvo
Model / Sales description	XC60 B4 D AWD Mom.Pro 145 A.5d
Key numbers HSN/TSN	9101 / BPQ
Vehicle identification number	YV1UZK5VCM1740476
Previous owners	1
First registration	24.11.2020
Mileage	102.579 km
Colour / Colour Code	grau
Fuel Type	Hybrid/Diesel
Cubic Capacity / Power	1.969 cm ³ / 145 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	25.07.2023 / 91.257 km
Next vehicle inspection	01.11.2023
Service documentation	Available
Trailer coupling	Swiveling
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 235/60 R18 front axle	Summer tyre on Aluminium rim	4/4
#2 235/60 R18 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Windshield	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Bumper front	Stone chip	Slight	
4	Fender le	Stone chip	Slight	
5	Door FL	Scratch	Slight	
6	Bumper rear	Scratch	Slight	
7	Door RR	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Door f.r.; ~ 430µm

A sample-like paint thickness measurement showed an increased paint thickness, which is

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024

almost certainly due to a repaired damage.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 04.04.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 16 overview pictures, 8 damage pictures

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024



Image 13



Image 14



Image 15

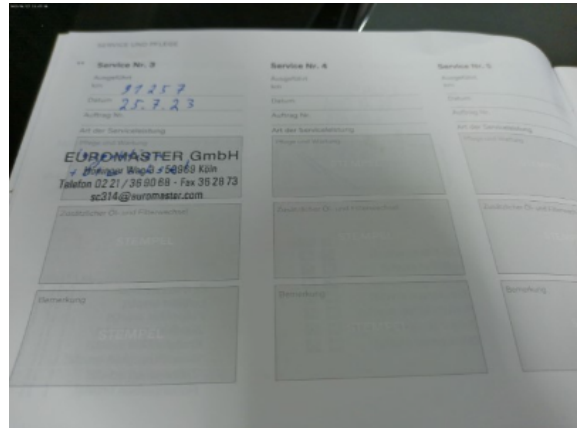


Image 16

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2

REPORTNUMBER: 202404-25795

If you have any questions, please state the report number and date

Date: 04.04.2024



Image 3: Siehe Pos.3



Image 4: Siehe Pos.3



Image 5: Siehe Pos.4



Image 6: Siehe Pos.5



Image 7: Siehe Pos.6



Image 8: Siehe Pos.7