



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

Report

Subject	Report
Inspection date/location	07.03.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	UN-C1009
Vehicle Identification Number	ZAREAEBN6K7616732



REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	07.03.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	UN-C1009
Vehicle type	Saloon
Manufacturer	Alfa Romeo
Model / Sales description	Giulia 2.0 Turbo 147 Aut.
Key numbers HSN/TSN	1742 / ABP
Vehicle identification number	ZAREAEBN6K7616732
Previous owners	1
First registration	02.07.2019
Mileage	103.991 km
Colour / Colour Code	blau
Fuel Type	Petrol
Cubic Capacity / Power	1.995 cm ³ / 147 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	12.05.2023 / 89.832 km
Next vehicle inspection	01.07.2024
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/50 R17 front axle	Summer tyre on Aluminium rim	6/6
#2 225/50 R17 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3		Scratch	Slight	
4	Bumper rear	Scratch	Slight	
5	Door FL	Scratch	Slight	
6		Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Fender ri.; ~ 200µm
- Door f.r.; ~ 200µm
- Door r.r.; ~ 190µm

A sample-like paint thickness measurement showed an increased paint thickness, which is

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

almost certainly due to a repaired damage.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 07.03.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 13 overview pictures, 6 damage pictures

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024



Image 7



Image 8



Image 9



Image 10



Image 11

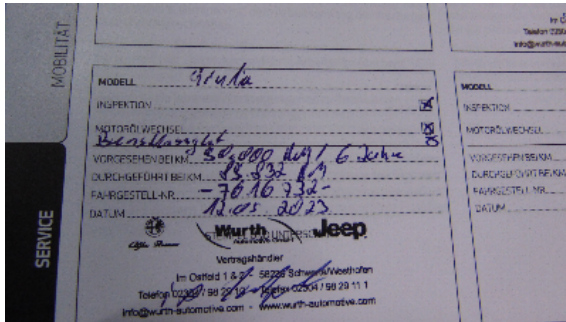


Image 12

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024



MOBILITÄT

MODELLEINTRAUF: *Jeep*

INSPEKTION:

MOTORÖLWECHSEL: *Benennung*

VORGESEHENE BEI KM: *50.000 km / 6 Jahre*

DURCHFÜHRT BEI KM: *58.000 km*

FAHRGESTELL-NR.: *-7016732-*

DATUM: *10.03.2024*

Wurth Jeep

Vertragshändler
Im Ortsteil 1 & 2 • 36226 Schwanau • Völkchen
Telefon 03222 79 222 • Fax 03222 79 222
info@wurth-automotive.com • www.wurth-automotive.com

Image 13

Damage pictures

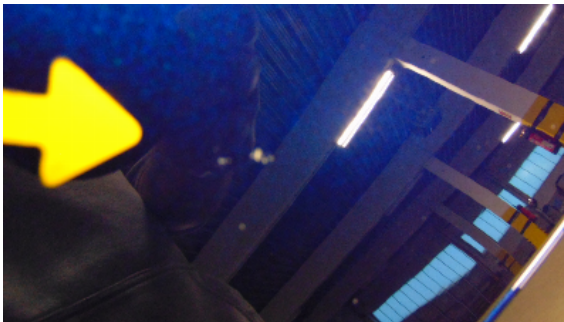


Image 1: siehe pos.1



Image 2: siehe pos.2

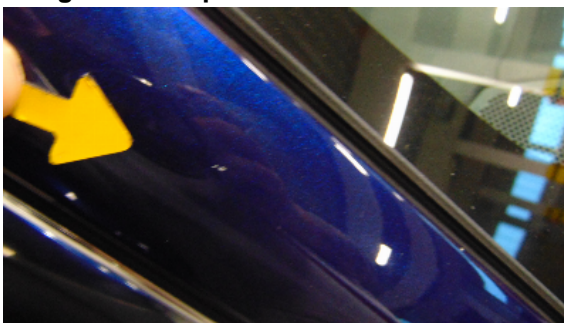


Image 3: siehe pos.3

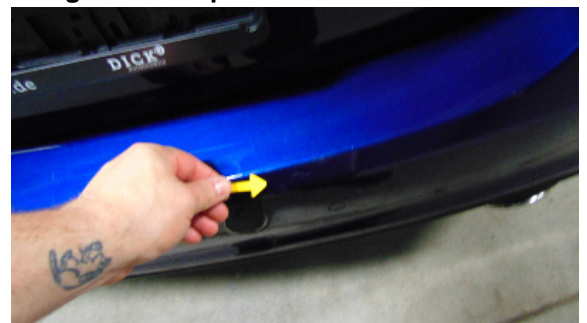


Image 4: siehe pos.4

REPORTNUMBER: 202403-25435

If you have any questions, please state the report number and date

Date: 07.03.2024

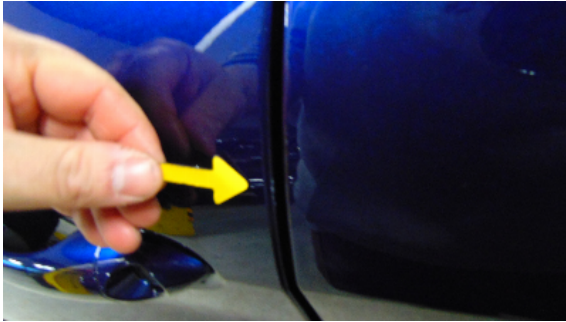


Image 5: siehe pos.5



Image 6: siehe pos.6