



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025

Report

Subject	Report
Inspection date/location	28.01.2025 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	GI-TB300
Vehicle Identification Number	WVWZZZ3CZLE143445



REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	28.01.2025 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	GI-TB300
Vehicle type	Estate Car
Manufacturer	VW
Model / Sales description	Passat Variant 2.0TDI SCR Business
Key numbers HSN/TSN	0603 / BQS
Vehicle identification number	WVWZZZ3CZLE143445
Previous owners	2
First registration	21.10.2020
Mileage	194.492 km
Colour / Colour Code	Schwarz
Fuel Type	Petrol
Cubic Capacity / Power	1.968 cm ³ / 110 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	2
Last maintenance	14.02.2024 / 152.344 km
Next vehicle inspection	01.11.2025
Service documentation	Available
Trailer coupling	Detachable
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 215/60 R16 front axle	Summer tyre on Aluminium rim	1/1
#2 215/60 R16 rear axle		3/3

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	good	good
Disc	good	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	
3	Mirror cap left	Stone chip	Slight	
4	Bumper rear	Scratch	Slight	
5	Side panel right	Dent	Slight	
6	Mirror cap right	Crack	Severe	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 180µm
- Roof; ~ 180µm
- Tailgate; ~ 70µm
- Fender le; ~ 160µm
- Door f.l.; ~ 150µm

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025

- Door r.l.; ~ 160µm
- Side panel le.; ~ 190µm
- Fender ri.; ~ 170µm
- Door f.r.; ~ 170µm
- Door r.r.; ~ 170µm
- Side panel ri.; ~ 370µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 29.01.2025



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 15 overview pictures, 8 damage pictures

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025



Image 7



Image 8



Image 9



Image 10



Image 11



Image 12

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025



Image 13



Image 14

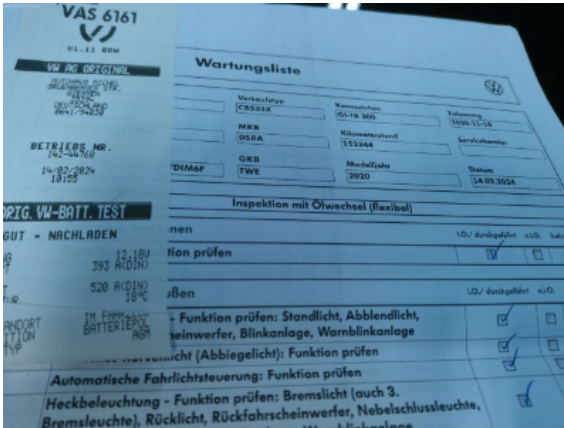


Image 15

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2

REPORTNUMBER: 202501-29195

If you have any questions, please state the report number and date

Date: 29.01.2025



Image 3: Siehe Pos.2



Image 4: Siehe Pos.3



Image 5: Siehe Pos.4



Image 6: Siehe Pos.4



Image 7: Siehe Pos.5



Image 8: Siehe Pos.6