



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Report

Subject	Report
Inspection date/location	17.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	K-RI771
Vehicle Identification Number	W0VECYHZJLJ530739



REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	17.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	K-RI771
Vehicle type	Minivan/Minibus
Manufacturer	Opel
Model / Sales description	Combo Life
Key numbers HSN/TSN	1844 / AHB
Vehicle identification number	W0VECYHZJLJ530739
Previous owners	1
First registration	02.04.2020
Mileage	189.073 km
Colour / Colour Code	weiß
Fuel Type	Diesel
Cubic Capacity / Power	1.499 cm ³ / 96 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	2
Last maintenance	20.09.2023 / 188.720 km
Next vehicle inspection	01.04.2025
Service documentation	Available
Trailer coupling	Detachable
Rain sensor	Available
Operating manual	Available
Repainting	Not Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/60 R16 front axle	Summer tyre on Steel rim	7/7
#2 205/60 R16 rear axle		7/7

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Scratch	Slight	
2	Bumper front	Scratch	Medium	
3	Fender ri		Medium	
4	Door FR	Scratch	Slight	
5	Bumper rear	Scratch	Slight	
6	Side panel left	Scratch	Slight	
7	Door RL	Scratch	Slight	
8	Mirror cap left	Scratch	Slight	
9	Fender le		Medium	

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 18.04.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 11 overview pictures, 9 damage pictures

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024



Image 7



Image 8



Image 9



Image 10

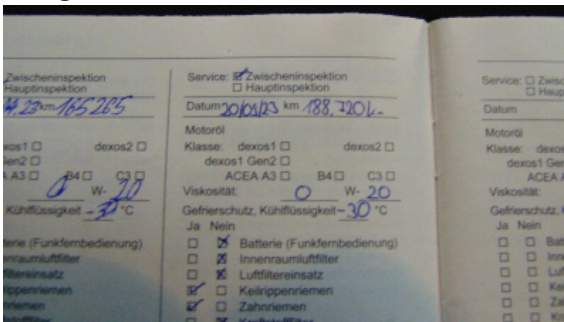


Image 11

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024

Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2



Image 3: siehe pos.3



Image 4: siehe pos.4



Image 5: siehe pos.5



Image 6: siehe pos.6



Image 7: siehe pos.7



Image 8: siehe pos.8

REPORTNUMBER: 202404-25963

If you have any questions, please state the report number and date

Date: 18.04.2024



Image 9: siehe pos.9