



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Inspection date/location	20.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	B-EQ1517
Vehicle Identification Number	WF0RXXWPGRKJ59602



REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	20.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	B-EQ1517
Vehicle type	Minivan/Minibus
Manufacturer	Ford
Model / Sales description	Transit Con.220 L1 Tre.
Key numbers HSN/TSN	8566 / BMN
Vehicle identification number	WF0RXXWPGRKJ59602
Previous owners	1
First registration	11.02.2020
Mileage	114.362 km
Colour / Colour Code	WEIß
Fuel Type	Diesel
Cubic Capacity / Power	1.499 cm ³ / 88 kW
Number of doors / seats	4 / 2
Transmission	Manual gearbox
Number of keys	2
Last maintenance	12.09.2022 / 85.539 km
Next vehicle inspection	01.02.2024
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/60 R16 front axle	Winter tyre on Steel rim with wheel cover	7/5
#2 205/60 R16 rear axle		6/6

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bumper front	Stone chip	Slight	
2	Bonnet	Stone chip	Slight	
3	Windshield	Stone chip	Medium	
4	Side panel left		Slight	
5	Fender ri		Slight	
6	Door RR		Slight	
7	Side panel right			

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Bumper fr.;
- Fender le; ~ 230µm
- Door f.l.; ~ 230µm

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

- Side panel le.; ~ 205µm
- Engine bonnet; ~ 255µm
- Roof; ~ 250µm
- Tailgate; ~ 225µm
- Door f.r.; ~ 245µm
- Door f.r.; ~ 240µm
- Door r.r.; ~ 225µm
- Side panel ri.; ~ 200µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

Test drive / Inspection

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 22.04.2024



Daniel Gawlik

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 7 damage pictures

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 7



Image 8



Image 9

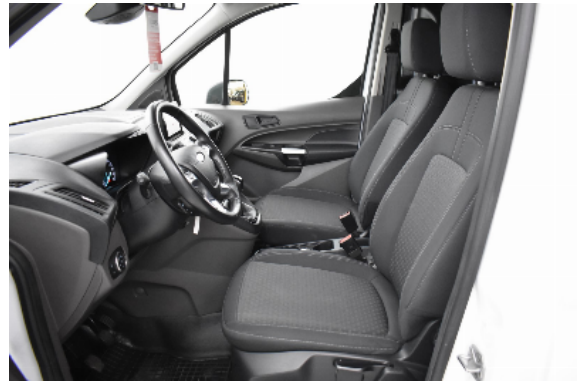


Image 10



Image 11



Image 12

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024

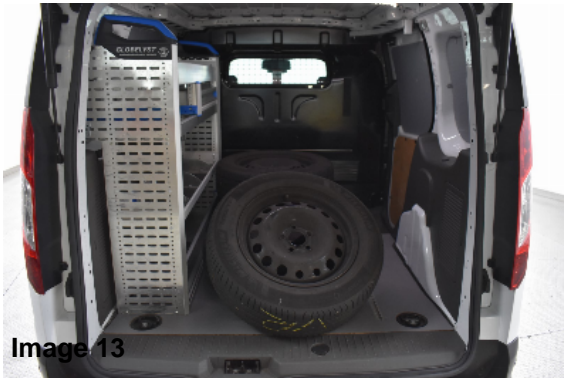


Image 13

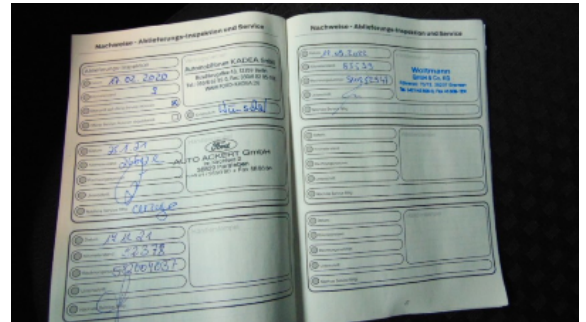


Image 14

Damage pictures



Image 1: Siehe Pos.1



Image 2: Siehe Pos.2



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4

REPORTNUMBER: 202404-26019

If you have any questions, please state the report number and date

Date: 22.04.2024



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6



Image 7: Siehe Pos.7