

Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date

# **Report**

Subject Report

Inspection date/location 08.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

**DE-36179** Bebra

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra

**Registration number** NR-A1425

Vehicle Identification Number WAUZZZF24MN018338

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 1 of 7



Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date

## Report

**Subject** Report

Client Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra 08.05.2024 | Dick Automobile e.K., Ernst-Abbe-Str. 2,

DE-36179 Bebra

Registration number NR-A1425 Vehicle type Saloon Manufacturer Audi

Model / Sales description A6 45 TDI quoattro design

Key numbers HSN/TSN 0588 / BTJ

Vehicle identification number WAUZZZF24MN018338

Previous owners 1

First registration 04.12.2020
Mileage 102.254 km
Colour / Colour Code schwarz
Fuel Type Hybrid/Diesel

Cubic Capacity / Power 2.967 cm<sup>3</sup> / 170 kW

Number of doors / seats 5 / 5

**Transmission** Automatic transmission

Number of keys 2

**Last maintenance** 03.08.2023 / 90.591 km

Next vehicle inspection01.12.2025Service documentationAvailableTrailer couplingSwivelingRain sensorAvailableOperating manualAvailableRepaintingFound

Plastic parts could not be evaluated by means of paint

thickness measurement.

**Inspection Condition** non-dismantled, roadworthy, traffic safe

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 2 of 7

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date Date: 10.05.2024

#### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/55 R18 front axle	Summer tyre on Aluminium rim	3/3
#2 225/55 R18 rear axle		4/4

The state of the tyres is roadworthy.

#### **Brakes**

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Bumper front	Stone chip	Slight	

## Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Engine bonnet; ~ 170µm
- Door r.r.; ~ 180µm
- Side panel ri.; ~ 160µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 3 of 7

Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date

## **Test drive / Inspection**

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

### Other information

18me

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 10.05.2024

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 2 damage pictures

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 4 of 7

Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date

# **Overview pictures**



Image 1



Image 3



Image 5



Image 2



Image 4



Image 6

Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date



Image 7



Image 9



Image 11



Image 8



Image 10



Image 12

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 6 of 7

Date: 10.05.2024

REPORTNUMBER: 202405-26232

If you have any questions, please state the report number and date





Image 14

# Damage pictures

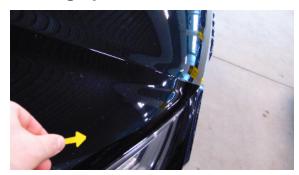


Image 1: siehe pos.1



Image 2: siehe pos.2

10.05.2024 VIN: WAUZZZF24MN018338; Report number: 202405-26232 Page 7 of 7