



Gerlach & Schröder GbR  
Nürnberger Str. 34  
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024

## Report

<b>Subject</b>	Report
<b>Inspection date/location</b>	02.05.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Registration number</b>	M-BC 6714
<b>Vehicle Identification Number</b>	VF7SXHNPYMT659213



REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024

## Report

<b>Subject</b>	Report
<b>Client</b>	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
<b>Inspection date/location</b>	02.05.2024   Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
<b>Registration number</b>	M-BC 6714
<b>Vehicle type</b>	Saloon
<b>Manufacturer</b>	Citroen
<b>Model / Sales description</b>	C3 PT S&S SHINE PACK 81 Aut.5d
<b>Key numbers HSN/TSN</b>	/
<b>Vehicle identification number</b>	VF7SXHNPYMT659213
<b>Previous owners</b>	1
<b>First registration</b>	20.01.2022
<b>Mileage</b>	43.618 km
<b>Colour / Colour Code</b>	
<b>Fuel Type</b>	Petrol
<b>Cubic Capacity / Power</b>	1.199 cm <sup>3</sup> / 81 kW
<b>Number of doors / seats</b>	5 / 5
<b>Transmission</b>	Automatic transmission
<b>Number of keys</b>	1
<b>Last maintenance</b>	07.12.2022 / 25.367 km
<b>Next vehicle inspection</b>	
<b>Service documentation</b>	Service history incomplete
<b>Trailer coupling</b>	No
<b>Rain sensor</b>	Available
<b>Operating manual</b>	Unavailable
<b>Repainting</b>	Not Found Plastic parts could not be evaluated by means of paint thickness measurement.
<b>Inspection Condition</b>	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024

### Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 205/50 R17 front axle	All-season tyre on Aluminium rim	6/6
#2 205/50 R17 rear axle		7/7

The state of the tyres is roadworthy.

### Brakes

	Front axle	Rear axle
Lining	deficient	adequate
Disc	deficient	adequate

### Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Aluminium rim RR	Scratch	Slight	
2	Aluminium rim FR	Scratch	Severe	
3	Bonnet	Stone chip	Slight	
4	Bumper front	Stone chip	Slight	
5	Fender le	Stone chip	Slight	
6	Side panel right	Stone chip	Slight	

### Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus pre-damages, repaintings or repairs can not be ruled out.

REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024

## Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

## Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 02.05.2024



---

Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

**Attached:** 15 overview pictures, 6 damage pictures

REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024

## Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024



Image 7



Image 8



Image 9



Image 10

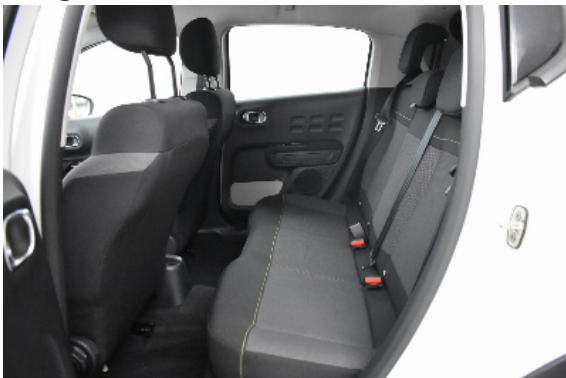


Image 11

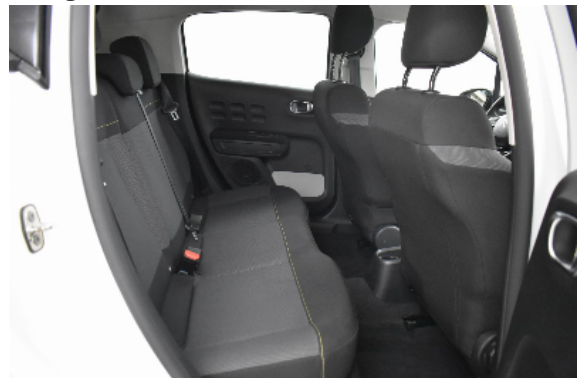


Image 12



REPORTNUMBER: 202405-26154

If you have any questions, please state the report number and date

Date: 02.05.2024



Image 3: Siehe Pos.3



Image 4: Siehe Pos.4



Image 5: Siehe Pos.5



Image 6: Siehe Pos.6