



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

Report

Subject	Report
Inspection date/location	14.12.2023 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	SK U 901
Vehicle Identification Number	SAJBB4BK1GKY14354

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	14.12.2023 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	SK U 901
Vehicle type	SUV/Off-road Vehicle/Pickup Truck
Manufacturer	Jaguar
Model / Sales description	XF
Key numbers HSN/TSN	1590 / ADZ
Vehicle identification number	SAJBB4BK1GKY14354
Previous owners	3
First registration	29.04.2016
Mileage	94.914 km
Colour / Colour Code	grau
Fuel Type	Diesel
Cubic Capacity / Power	2.992 cm ³ / 221 kW
Number of doors / seats	5 / 5
Transmission	Automatic transmission
Number of keys	2
Last maintenance	01.08.2022 / 83.889 km
Next vehicle inspection	01.07.2024
Service documentation	Available
Trailer coupling	No
Rain sensor	Available
Operating manual	Available
Repainting	Found
	Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 245/45 R18 front axle	Summer tyre on Aluminium rim	6/6
#2 245/45 R18 rear axle		5/5

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	near-new	good
Disc	near-new	good

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Bonnet	Stone chip	Slight	
2	Door RR	Scratch	Slight	
3	Side panel left	Scratch	Slight	

Previous damages / Repaintings

The vehicle was found to have been properly and professionally repaired.

Essentially, the following vehicle parts were replaced or repaired:

- Tailgate; ~ 620µm
- Fender ri.; ~ 170µm
- Door f.r.; ~ 200µm
- Door r.r.; ~ 180µm
- Side panel ri.; ~ 250µm

A sample-like paint thickness measurement showed an increased paint thickness, which is almost certainly due to a repaired damage.

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 15.12.2023



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 14 overview pictures, 3 damage pictures

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023



Image 7



Image 8



Image 9



Image 10



Image 11

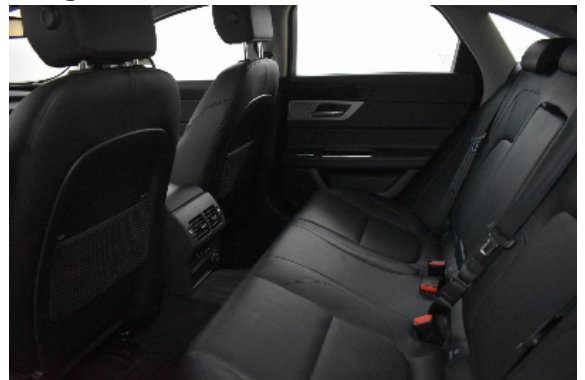


Image 12

REPORTNUMBER: 202312-24556

If you have any questions, please state the report number and date

Date: 15.12.2023

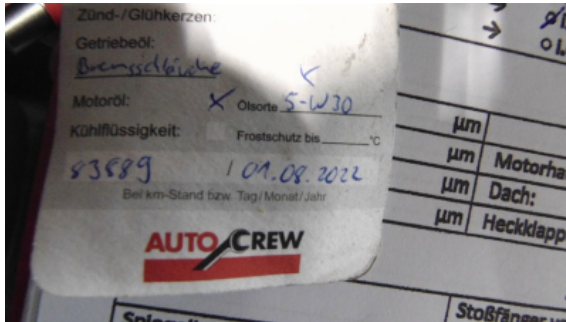


Image 13

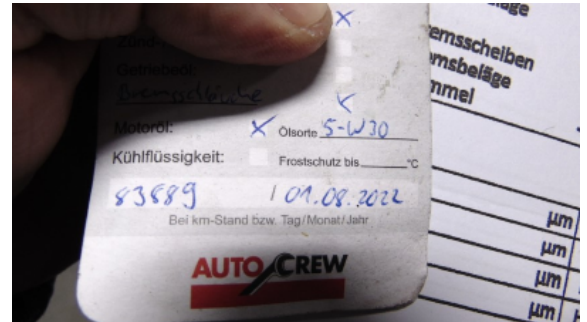


Image 14

Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2



Image 3: siehe pos.3