



Gerlach & Schröder GbR
Nürnberger Str. 34
DE-36199 Rotenburg a.d. Fulda/Lisp.

REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

Report

Subject	Report
Inspection date/location	29.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Registration number	L AZ 2020
Vehicle Identification Number	VF3LRHNYHES101760



REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

Report

Subject	Report
Client	Dick Automobile e.K., Otto-Hahn-Str. 4-6, DE-36179 Bebra
Inspection date/location	29.04.2024 Dick Automobile e.K., Ernst-Abbe-Str. 2, DE-36179 Bebra
Registration number	L AZ 2020
Vehicle type	
Manufacturer	Peugeot
Model / Sales description	308
Key numbers HSN/TSN	3003 / ATM
Vehicle identification number	VF3LRHNYHES101760
Previous owners	3
First registration	19.06.2014
Mileage	141.170 km
Colour / Colour Code	weiß
Fuel Type	Petrol
Cubic Capacity / Power	1.199 cm ³ / 96 kW
Number of doors / seats	5 / 5
Transmission	Manual gearbox
Number of keys	2
Last maintenance	Unknown
Next vehicle inspection	01.02.2026
Service documentation	Nonexistent
Trailer coupling	Detachable
Rain sensor	Available
Operating manual	Available
Repainting	Not Found Plastic parts could not be evaluated by means of paint thickness measurement.
Inspection Condition	non-dismantled, roadworthy, traffic safe



REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

Tires / Rims

Axis / Size	Tires	Profile [mm]
#1 225/45 R17 front axle	Winter tyre on Aluminium rim	7/7
#2 225/45 R17 rear axle		7/7

The state of the tyres is roadworthy.

Brakes

	Front axle	Rear axle
Lining	adequate	adequate
Disc	adequate	adequate

Value decreasing factors / signs of usage

The report determines only damages and faults that exceed the normal wear and tear of the vehicle corresponding to the running time / mileage or if specific values are below the usual wear measurement.

Nr.	Component	Damage	Severity	Comment
1	Aluminium rim FR	Scratch	Medium	
2	Aluminium rim RL	Scratch	Medium	
3	Bonnet	Scratch	Slight	
4	Door FR	Scratch	Slight	
5	Tailgate panel	Scratch	Slight	
6	Side panel left	Scratch	Slight	
7	Door RL	Scratch	Slight	
8	Door FL	Dent	Medium	

Previous damages / Repaintings

As far as without further investigations recognizable, at the inspection **no repaired previous damages are detectable**. A random paint thickness measurement showed no abnormalities.

Plastic parts could not be evaluated by means of paint thickness measurement. Thus

REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

pre-damages, repainting or repairs can not be ruled out.

Test drive / Inspection

There was a short drive on the company site.

A test run of the engine was carried out.

At the time of the inspection the vehicle was not authorized for public roads.

An impairment of traffic safety was not detected.

The inspection included an external inspection of the vehicle without the dismantling of trim parts etc.

Other information

The inspection conditions were sufficient for the investigation of the vehicle.

Bebra 29.04.2024



Nico Emme

This printed copy was produced electronically. The appointed expert assures that the content correctly reflects the statements made by him. It is valid without an original signature.

Attached: 12 overview pictures, 8 damage pictures

REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

Overview pictures



Image 1



Image 2



Image 3



Image 4



Image 5



Image 6

REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024



Image 7



Image 8



Image 9



Image 10



Image 11

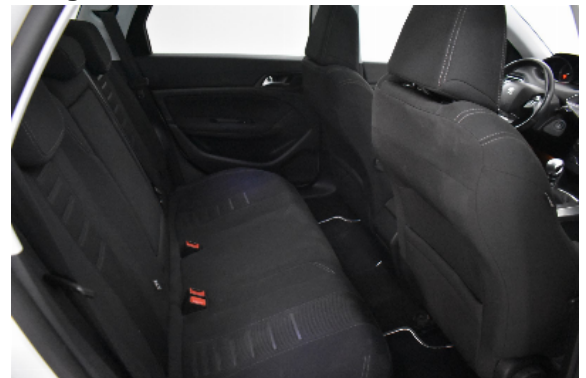


Image 12

REPORTNUMBER: 202404-26109

If you have any questions, please state the report number and date

Date: 29.04.2024

Damage pictures



Image 1: siehe pos.1



Image 2: siehe pos.2



Image 3: siehe pos.3



Image 4: siehe pos.4



Image 5: siehe pos.5



Image 6: siehe pos.6

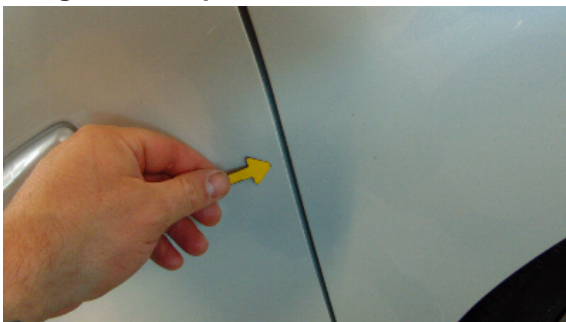


Image 7: siehe pos.7



Image 8: siehe pos.8